CT 350 LSX

0 1 1 1

373129003 - GB

USE AND MAINTENANCE MANUAL

DRAFT

© MOSA - 19/01/11 37312M00
preparato da UPT
approvato da DITE

The CT 350 engine driven welder is a unit which ensures the function as:
a) a current source for are welding
b) a current source for the auxiliary generation

The welding generator set is a source of DC electric power, driven by an internal combustion engine, which allows to perform arc welding processes with different types of electrodes and, with the CC/CV version, also wire welding. Besides, the generation set can provide ac 50 Hz auxiliary power, both three-phase and single phase, usable for the various needs associated with the welding. The engine which drives the generator set is a two-cylinder diesel type, air cooled, while the alternator is an asynchronous three-phase type. The welding current control is performed by means of a high frequency (20 kHz) “chopper” technique, while the regulation board is implemented with analogue technology.

From a mechanical viewpoint, the machine is composed of a bunded basement and a roll-bar, which support the engine-alternator assembly. The canopy includes a protection cover for the front panel and two lateral doors intended to allow the routine maintenance operations. For the extraordinary maintenance the canopy can be removed in a fairly simple way.

On the front panel there are the engine protection unit (EP7) and the welding control unit (WAC). Located on EP7 there are the start key and a few indicator lights which monitor the engine status. The WAC hosts the regulation knob of the welding current (which regulates also the welding voltage in the CC/CV version) and the arc force knob. The auxiliary power sockets and the welding sockets are also placed on the front panel.

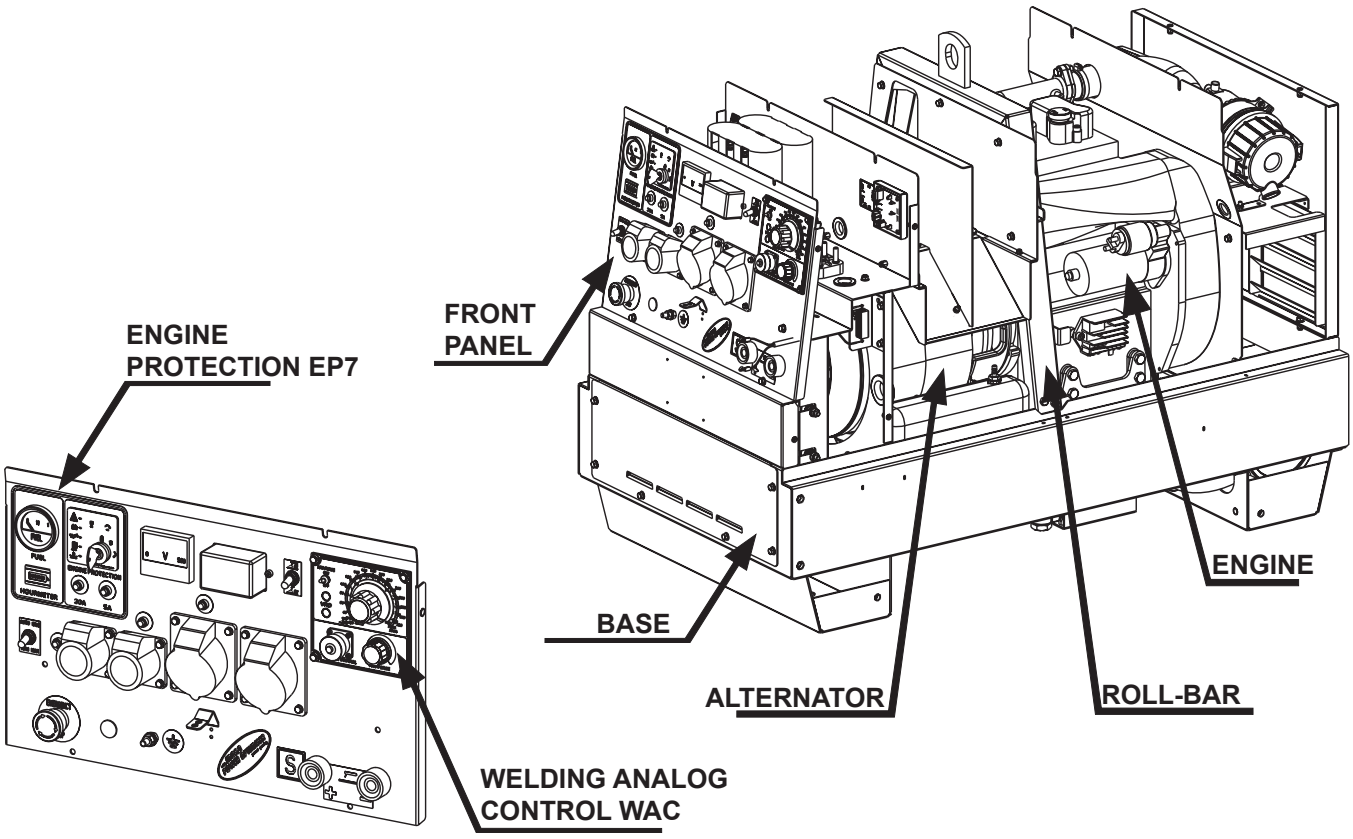

IQNet

THE INTERNATIONAL CERTIFICATION NETWORK

CERTIFICATE

IQNet and its partner

CISQ/ICIM

hereby certify that the organization

BCS S.p.A.

***Head Office and Operative Unit*: Viale Mazzini, 161 - I-20081 Abbiategrasso (MI)**
***Operative Units:* Via Valbrina, 17/19 - I-42045 Luzzara (RE)**
Viale Europa, 59 - I-20090 Cusago (MI)

for the following field of activities

Design, production and servicing of tractors, agricultural and green maintenance machines, engine driven welders and generating sets.

has implemented and maintains a

Quality Management System

which fulfills the requirements of the following standard

ISO 9001:2008

Issued on: 2010-10-19
Validity date: 2012-03-05
Registration Number: IT-3722

Michael Drechsel
President of IQNET

Gianrenzo Prati
President of CISQ

IQNet Partners*:
AENOR *Spain* AFNOR Certification *France* AIB-Vincotte International *Belgium* ANCE *Mexico* APCER *Portugal* CCC *Cyprus* CISQ *Italy* CQC *China* CQM *China* CQS *Czech Republic* Cro Cert *Croatia* DQS Holding GmbH *Germany* DS *Denmark* ELOT *Greece* FCAV *Brazil* FONDONORMA *Venezuela* HKQAA *Hong Kong China* ICONTEC *Colombia* IMNC *Mexico* Inspecta Certification *Finland* IRAM *Argentina* JQA *Japan* KFQ *Korea* MSZT *Hungary* Nemko AS *Norway* NSAI *Ireland* PCBC *Poland* Quality Austria *Austria* RR *Russia* SII *Israel* SIQ *Slovenia* SIRIM QAS International *Malaysia* SQS *Switzerland* SRAC *Romania* TEST St Petersburg *Russia* TSE *Turkey* YUQS *Serbia*
IQNet is represented in the USA by: AFNOR Certification, CISQ, DQS Holding GmbH and NSAI Inc.
* The list of IQNet partners is valid at the time of issue of this certificate. Updated information is available under www.iqnet-certification.com

CISQ is a member of IQNet
www.iqnet-certification.com

IQNet, the association of the world's first class certification bodies, is the largest provider of management System Certification in the world. IQNet is composed of more than 30 bodies and counts over 150 subsidiaries all over the globe.

ICIM
www.icim.it

CERTIFICATO n. 0192/5
CERTIFICATE No.

SI CERTIFICA CHE IL SISTEMA DI GESTIONE PER LA QUALITA' DI
WE HEREBY CERTIFY THAT THE QUALITY MANAGEMENT SYSTEM OPERATED BY

BCS S.p.A.

UNITA' OPERATIVE
OPERATIVE UNITS

Sede e Unità Operativa
Viale Mazzini, 161 - 20081 Abbiategrasso (MI)
Unità Operative
Via Valbrina, 17/19 - 42045 Luzzara (RE)
Viale Europa, 59 - 20090 Cusago (MI)
Italia

E' CONFORME ALLA NORMA
IS IN COMPLIANCE WITH THE STANDARD

UNI EN ISO 9001:2008

PER LE SEGUENTI ATTIVITA'
FOR THE FOLLOWING ACTIVITIES

EA: 18

Progettazione, produzione ed assistenza di trattori, macchine per agricoltura e manutenzione del verde, motosaldatrici e gruppi elettrogeni.

Design, production and servicing of tractors, agricultural and green maintenance machines, engine driven welders and generating sets.

Riferirsi al Manuale della Qualità per l'applicabilità dei requisiti della norma di riferimento.
Refer to Quality Manual for details of application to reference standard requirements.
Il presente certificato è soggetto al rispetto del regolamento per la certificazione dei sistemi di gestione per la qualità delle aziende.
The use and the validity of this certificate shall satisfy the requirements of the rules for the certification of company quality management systems.

Data emissione *First issue*	Emissione corrente *Current issue*	Data di scadenza *Expiring date*
30/05/1994	19/10/2010	05/03/2012

ICIM S.p.A.
Piazza Don Enrico Mapelli, 75 - 20099 Sesto San Giovanni (MI)

Il presente documento annulla e sostituisce il certificato di pari numero emesso in data 06/03/2009

CISQ è la Federazione Italiana di Organismi di Certificazione dei sistemi di gestione aziendale
CISQ is the Italian Federation of management system Certification Bodies

ACCREDIA L'ENTE ITALIANO DI ACCREDITAMENTO
SQ Nº 004A SSI Nº 008G
SGA Nº 005D PRD Nº 004B
PRS Nº 094C IFS Nº 006E
Membro degli accordi di Mutuo Riconoscimento EA e IAF
Signatory of EA and IAF Mutual Recognition Agreement

FEDERAZIONE CISQ
www.cisq.com

ICIM CISQ IQNet
ISO 9001:2008 - Cert. 0192

UNI EN ISO 9001 : 2008

MOSA has certified its quality system according to UNI EN ISO 9001:2008 to ensure a constant, highquality of its products. This certification covers thedesign, production and servicing of engine drivenwelders and generating sets.

The certifying institute, ICIM, which is a member ofthe International Certification Network IQNet, awarded the official approval to MOSA after an examination of its operations at the head office andplant in Cusago (MI), Italy.

This certification is not a point of arrival but a pledgeon the part of the entire company to maintain a levelof quality of both its products and services whichwill continue to satisfy the needs of its clients, aswell as to improve the transparency and thecommunications regarding all the company's activesin accordance with the official procedures and inharmony with the MOSA Manual of Quality.

The advantages for MOSA clients are:

·Constant quality of products and services at thehigh level which the client expects;

· Continuous efforts to improve the products andtheir performance at competitive conditions;

· Competent support in the solution of problems;

· Information and training in the correct applicationand use of the products to assure the security ofthe operator and protect the environment;

· Regular inspections by ICIM to confirm that therequirements of the company's quality systemand ISO 9001 are being respected.

All these advantages are guaranteed by the CERTIFICATE OF QUALITY SYSTEM No.0192 issued by ICIM S.p.A. - Milano (Italy) - www.icim.it

M 0 DESCRIPTION OF THE MACHINE
M 01 QUALITY SYSTEM
M 1.01 COPYRIGHT
M 1.1 NOTES
M 1.4 CE MARK
M 1.4.1 DECLARATION OF CONFORMITY
M 1.5 TECHNICAL DATA
M 1.6 TECHNICAL DATA
M 2 SAFETY PRECAUTIONS
M 2.1 SYMBOLS
M 2.5 -…. INSTALLATION AND ADVICE BEFORE USE
M 2.6 INSTALLATION AND ADVICE
M 2.7 INSTALLATION AND DIMENSIONS
M 3 UNPACKING
M 4 - 4.1 TRANSPORT AND DISPLACEMENTS
M 6.17 MONTAGE CTM/CTL 330
M 20 SET-UP FOR OPERATION
M 21 STARTING THE ENGINE
M 22 STOPPING THE ENGINE
M 30 CONTROLS LEGEND
M 31 CONTROLS
M 33 ... WELDING ANALOG CONTROL (WAC)
M 34 USE AS A WELDER
M 37 USE AS A GENERATOR
M 38.10 REMOTE CONTROL RC2
M 38.12 REMOTE CONTROL TC7
M 40.1 TROUBLE SHOOTING
M 43... MAINTENANCE
M 45 STORAGE
M 46 CUST OFF
M 55 RECOMMENDED ELECTRODES
M 60 LEGEND ELECTRICAL SYSTEM
M 61 ELECTRICAL SYSTEM

03/06/10 37310-GB

⚠ ATTENTION

This use and maintenance manual is an important part of the machines in question.
The assistance and maintenance personel must keep said manual at disposal, as well as that for the engine and alternator (if the machine is synchronous) and all other documentation about the machine.

We advise you to pay attention to the pages concerning the security (see page M1.1).

MOSA

© All rights are reserved to said Company.

It is a property logo of MOSA division of B.C.S. S.p.A. All other possible logos contained in the documentation are registered by the respective owners.

➠ The reproduction and total or partial use, in any form and/or with any means, of the documentation is allowed to nobody without a written permission by MOSA division of B.C.S. S.p.A.

To this aim is reminded the protection of the author's right and the rights connected to the creation and design for communication, as provided by the laws in force in the matter.

In no case MOSA division of B.C.S. S.p.A. will be held responsible for any damaga, direct or indirect, in relation with the use of the given information.

MOSA division of B.C.S. S.p.A. does not take any responsibility about the shown information on firms or individuals, but keeps the right to refuse services or information publication which it judges discutible, unright or illegal.

INFORMATION

Dear Customer,
We wish to thank you for having bought from MOSA a high quality set.

Our sections for Technical Service and Spare Parts will work at best to help you if it were necessary.

To this purpose we advise you, for all control and overhaul operations, to turn to the nearest authorized Service Centre, where you will obtain a prompt and specialized intervention.

☞ In case you do not profit on these Services and some parts are replaced, please ask and be sure that are used exclusively original MOSA parts; this to guarantee that the performances and the initial safety prescribed by the norms in force are re-established.

☞ *The use of **non original spare parts will cancel immediately** any guarantee and Technical Service obligation from MOSA.*

NOTES ABOUT THE MANUAL

Before actioning the machine please read this manual attentively. Follow the instructions contained in it, in this way you will avoid inconveniences due to negligence, mistakes or incorrect maintenance. The manual is for qualified personnel, who knows the rules: about safety and health, installation and use of sets movable as well as fixed.

You must remember that, in case you have difficulties for use or installation or others, our Technical Service is always at your disposal for explanations or interventions.

The manual for Use Maintenance and Spare Parts is an integrant part of the product. It must be kept with care during all the life of the product.
In case the machine and/or the set should be yielded to another user, this manual must also given to him.
Do not damage it, do not take parts away, do not tear pages and keep it in places protected from dampness and heat.

You must take into account that some figures contained in it want only to identify the described parts and therefore might not correspond to the machine in your possession.

INFORMATION OF GENERAL TYPE

In the envelope given together with the machine and/or set you will find: the manual for Use Maintenance and Spare Parts, the manual for use of the engine and the tools (if included in the equipment), the guarantee (in the countries where it is prescribed by law).

Our products have been designed for the use of generation for welding, electric and hydraulic system; ANY OTHER DIFFERENT USE NOT INCLUDED IN THE ONE INDICATED, relieves MOSA from the risks which could happen or, anyway, from that which was agreed when selling the machine; MOSA excludes any responsibility for damages to the machine, to the things or to persons in this case.

Our products are made in conformity with the safety norms in force, for which it is advisable to use all these devices or information so that the use does not bring damage to persons or things.

While working it is advisable to keep to the personal safety norms in force in the countries to which the product is destined (clothing, work tools, etc.).

Do not modify for any motive parts of the machine (fastenings, holes, electric or mechanical devices, others..) if not duly authorized in writing by MOSA: the responsibility coming from any potential intervention will fall on the executioner as in fact he becomes maker of the machine.

☞ ***Notice:** this manual does not engage MOSA, who keeps the faculty, apart the essential characteristics of the model here described and illustrated, to bring betterments and modifications to parts and accessories, without putting this manual uptodate immediately.*

Any of our product is labelled with CE marking attesting its conformity to appliable directives and also the fulfillment of safety requirements of the product itself; the list of these directives is part of the declaration of conformity included in any machine standard equipment.
Here below the adopted symbol:
CE marking is clearly readable and unerasable and it can be either part of the data-plate (A) or

placed as a sticker near the data-plate (B)

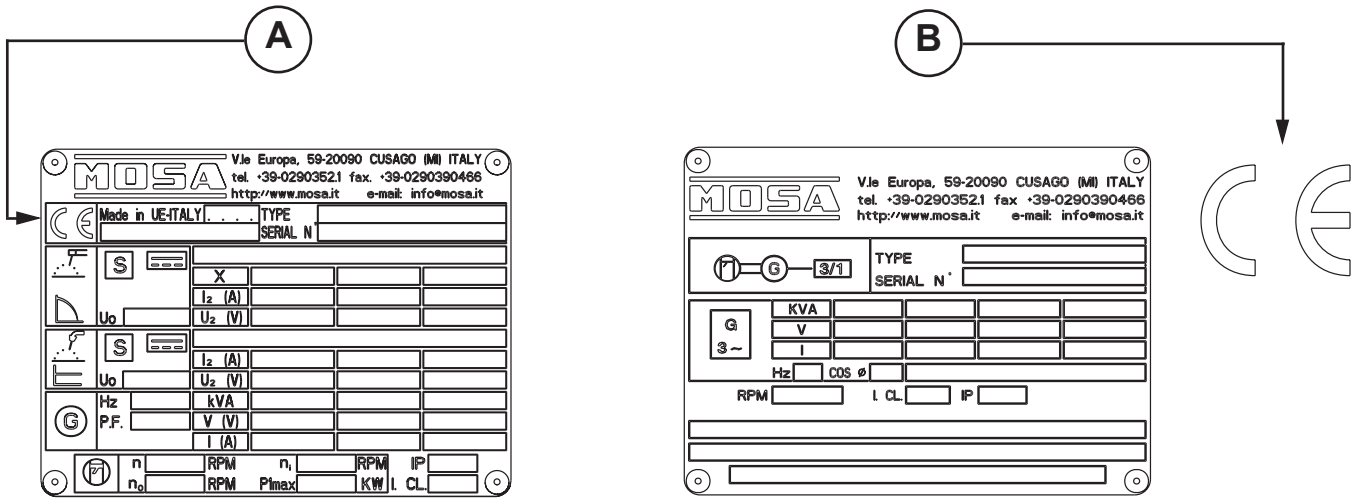

Furthermore, on each model it is shown the noise level value; the symbol used is the following:

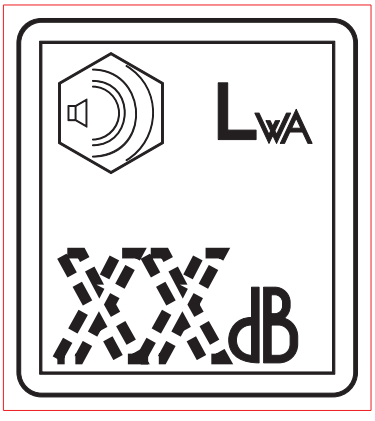

The indication is shown in a clear, readable and indeleble way on a sticker.

BCS S.p.A.
Sede legale:
Via Marradi 1
20123 Milano - Italia

Stabilimento di Cusago, 20090 (MI) - Italia
V.le Europa 59
Tel.: +39 02 903521
Fax: +39 02 90390466

ISO 9001:2000 - Cert. 0192

DICHIARAZIONE DI CONFORMITA'

CE

Déclaration de Conformité – Declaration of Conformity – Konformitätserklärung
Conformiteitsverklaring – Declaración de Conformidad

BCS S.p.A. dichiara sotto la propria responsabilità che la macchina:
BCS S.p.A. déclare, sous sa propre responsabilité, que la machine:
BCS S.p.A. declares, under its own responsibility, that the machine:
BCS S.p.A. erklärt, daß die Aggregate:
BCS S.p.A. verklaard, onder haar eigen verantwoordelijkheid, dat de machine:
BCS S.p.A. declara bajo su responsabilidad que la máquina:

GRUPPO ELETTROGENO DI SALDATURA / WELDING GENERATOR ☐

GRUPPO ELETTROGENO / POWER GENERATOR ☐

Marchio / Brand : _MOSA_____

Modello / Model : _____

Matricola / Serial number : _____

FAC SIMILE

è conforme con quanto previsto dalle Direttive Comunitarie e relative modifiche:
est en conformité avec ce qui est prévu par les Directives Communautaires et relatives modifications:
conforms with the Community Directives and related modifications:
mit den Vorschriften der Gemeinschaft und deren Ergänzungen übereinstimmt:
in overeenkomst is met de inhoud van gemeenschapsrichtlijnemen gerelateerde modificaties:
comple con los requisítos de la Directiva Comunitaria y sus anexos:

2006/42/CE - 2006/95/CE - 2004/108/CE

Nome e indirizzo della persona autorizzata a costituire il fascicolo tecnico :
Nom et adresse de la personne autorisée à composer le Dossier Technique :
Person authorized to compile the technical file and address :
Name und Adresse der zur Ausfüllung der technischen Akten ermächtigten Person :
Persoon bevoegd om het technische document , en bedrijf gegevens in te vullen
Nombre y dirección de la persona autorizada a componer el expediente técnico :

ing. Benso Marelli - Amministratore Delegato / CEO; V.le Europa 59, 20090 Cusago (MI) - Italy

Cusago,

Ing. Benso Marelli
Amministratore Delegato
CEO

Technical data	CT 350 LSX CC/CV
GENERATOR	
Three-phase generation	10 kVA / 400 V / 14.4 A
Single-phase generation	5 kVA / 230 V / 21.7 A
Single-phase generation	2.5 kVA / 110 V / 22.7 A
Single-phase generation	5 kVA / 48 V / 104 A
Frequency	50 Hz
Cos φ	0.9
ALTERNATOR	Self-excited, self-regulated
Type	three-phase, asynchronous
Insulating class	H
ENGINE	
Mark / Model	Lombardini / 12LD477.2
Type / Cooling system	Diesel 4-tempi / aria
Cylinders / Displacement	2 / 954 cm^3
Output max	14 kW (19 HP)
Speed	3000 giri/min
Fuel consumption	2.5 l/h
Engine oil capacity	3 l
Starter	Elettrico
GENERAL SPECIFICATIONS	
Tank capacity	38 l
Running time (at duty cycle 60%)	15.2 h
Protection	IP 23
Dimensions / max. Lxwxh (mm) *	1230x690x925
Weight *	345 Kg
Measured acoustic power LwA (pressure LpA)*	94 dB(A) (69 dB(A) @ 7 m)
Guaranteed acoustic power LwA (pressure LpA)*	95 dB(A) (70 dB(A) @ 7 m)

* Dimensions and weight are inclusive of all parts without wheels and towbar (CTM).

POWER

Declared power according to ISO 3046-1 (temperature 25°C, 30% relative humidity, altitude 100 m above sea level).
It's admitted overload of 10% each hour every 12 h.
In an **approximative** way one reduces: of 1% every 100 m altitude and of 2.5% for every 5°C above 25°C.

ACOUSTIC POWER LEVEL

ATTENTION: The concrete risk due to the machine depends on the conditions in which it is used. Therefore, it is up to the end-user and under his direct responsibility to make a correct evaluation of the same risk and to adopt specific precautions (for instance, adopting a I.P.D. -Individual Protection Device)

Acoustic Noise Level (L_{WA}) - Measure Unit dB(A): it stands for acoustic noise released in a certain delay of time. This is not submitted to the distance of measurement.

Acoustic Pressure (Lp) - Measure Unit dB(A): it measures the pressure originated by sound waves emission. Its value changes in proportion to the distance of measurement.

The here below table shows examples of acoustic pressure (Lp) at different distances from a machine with Acoustic Noise Level (L_{WA}) of 95 dB(A)

Lp a 1 meter = 95 dB(A) - 8 dB(A) = 87 dB(A)
Lp a 4 meters = 95 dB(A) - 20 dB(A) = 75 dB(A)
Lp a 7 meters = 95 dB(A) - 25 dB(A) = 70 dB(A)
Lp a 10 meters = 95 dB(A) - 28 dB(A) = 67 dB(A)

PLEASE NOTE: the symbol LWA 2000/14/CE when with acoustic noise values, indicates that the device respects noise emission limits according to 2000/14/CE directive.

Technical data — CT 350 LSX

C.C. WELDING

Duty cycle	350A/35% - 300A/60% - 250A/100%
Welding current electronic regulation	20 - 350A
Open circuit voltage	70V

C.C. STATIC CHARACTERISTICS

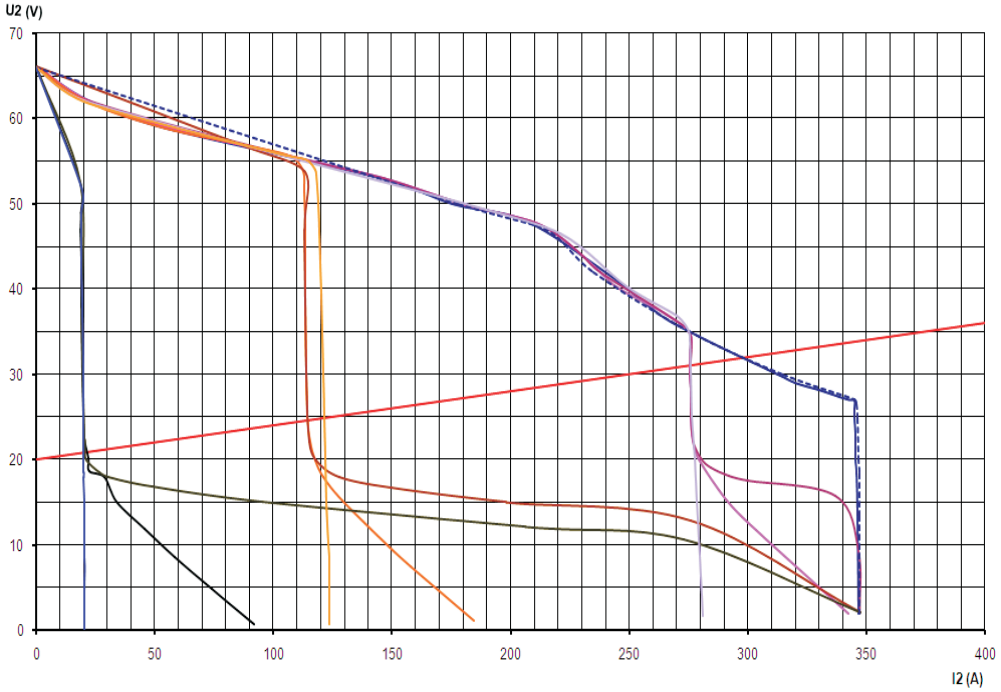

SIMULTANEOUS UTILISATION LIMITS								
WELDING CURRENT (CC) [A]	0	50	100	150	200	250	300	350
AUXILIARY POWER 3-PHASE [Kw]	8.0	8.0	7.0	5.5	3.5	2.0	0	0
AUXILIARY POWER SINGLE PHASE [Kw]	4.0	4.0	4.0	4.0	3.5	2.0	0	0

SYMBOLS IN THIS MANUAL

- The symbols used in this manual are designed to call your attention to important aspects of the operation of the machine as well as potential hazards and dangers for persons and things.

IMPORTANT ADVICE

- Advice to the User about the safety:

☞ N.B.: The information contained in the manual can be changed without notice.
Potential damages caused in relation to the use of these instructions will not be considered because these are only indicative.
Remember that the non observance of the indications reported by us might cause damage to persons or things.
It is understood, that local dispositions and/or laws must be respected.

WARNING

Situations of danger - no harm to persons or things

Do not use without protective devices provided
Removing or disabling protective devices on the machine is prohibited.

Do not use the machine if it is not in good technical condition
The machine must be in good working order before being used. Defects, especially those which regard the safety of the machine, must be repaired before using the machine.

SAFETY PRECAUTIONS

DANGEROUS

This heading warns of an immediate danger for persons as well for things. Not following the advice can result in serious injury or death.

WARNING

This heading warns of situations which could result in injury for persons or damage to things.

CAUTION

To this advice can appear a danger for persons as well as for things, for which can appear situations bringing material damage to things.

IMPORTANT

NOTE

ATTENTION

These headings refer to information which will assis you in the correct use of the machine and/or accessories.

SYMBOLS

STOP **-** Read absolutely and be duly attentive

Read and pay due attention

GENERAL ADVICE **-** If the advice is not respected damage can happen to persons or things.

HIGH VOLTAGE **-** Attention High Voltage. There can be parts in voltage, dangerous to touch. The non observance of the advice implies life danger.

FIRE **-** Danger of flame or fire. If the advice is not respected fires can happen.

HEAT **-** Hot surfaces. If the advice is not respected burns or damage to things can be caused.

EXPLOSION **-** Explosive material or danger of explosion. in general. If the advice is not respected there can be explosions.

WATER **-** Danger of shortcircuit. If the advice is not respected fires or damage to persons can be caused.

SMOKING **-** The cigarette can cause fire or explosion. If the advice is not respected fires or explosions can be caused.

ACIDS **-** Danger of corrosion. If the advice is not respected the acids can cause corrosions with damage to persons or things.

WRENCH **-** Use of the tools. If the advice is not respected damage can be caused to things and even to persons.

PRESSION **-** Danger of burns caused by the expulsion of hot liquids under pressure.

ACCES FORBIDDEN *to non authorizad* peaple.

PROHIBITIONS No harm for persons

Use only with safety clothing -

It is compulsory to use the personal protection means given in equipment.

Use only with safety clothing -

It is compulsory to use the personal protection means given in equipment.

Use only with safety protections -

It is a must to use protection means suitable for the different welding works.

Use with only safety material -

It is prohibited to use water to quench fires on the electric machines.

Use only with non inserted voltage -

It is prohibited to make interventions before having disinserted the voltage.

No smoking -

It is prohibited to smoke while filling the tank with fuel.

No welding -

It is forbidden to weld in rooms containing explosive gases.

ADVICE <u>No harm for persons and things</u>

Use only with safety tools, adapted to the specific use -

It is advisable to use tools adapted to the various maintenance works.

Use only with safety protections, specifically suitable

It is advisable to use protections suitable for the different welding works.

Use only with safety protections -

It is advisable to use protections suitable for the different daily checking works.

Use only with safety protections -

It is advisable to use all protections while shifting the machine.

Use only with safety protections -

It is advisable to use protections suitable for the different daily checking works.and/or of maintenance.

©MOSA 1.0-06/00

The installation and the general advice concerning the operations, are finalized to the correct use of the machine, in the place where it is used as generator group and/or welder.

ENGINE	CHECKING BOARD
Stop engine when fueling	Do not touch electric devices if you are barefoot or with wet clothes.
Do not smoke, avoid flames, sparks or electric tools when fueling.	
Unscrew the cap slowly to let out the fuel vapours.	Always keep off leaning surfaces during work operations
Slowly unscrew the cooling liquid tap if the liquid must be topped up.	
The vapor and the heated cooling liquid under pressure can burn face, eyes, skin.	Static electricity can demage the parts on the circuit.
Do not fill tank completely.	
Wipe up spilled fuel before starting engine.	An electric shock can kill
Shut off fuel of tank when moving machine (where it is assembled).	
Avoid spilling fuel on hot engine.	
Sparks may cause the explosion of battery vapours	

☞ **FIRST AID.** In case the operator shold be sprayed by accident, from corrosive liquids a/o hot toxic gas or whatever event which may cause serious injuries or death, predispose the first aid in accordance with the ruling labour accident standards or of local instructions.

Skin contact	Wash with water and soap
Eyes contact	Irrigate with plenty of water, if the irritation persists contact a specialist
Ingestion	Do not induce vomit as to avoid the intake of vomit into the lungs, send for a doctor
Suction of liquids from lungs	If you suppose that vomit has entered the lungs (as in case of spontaneous vomit) take the subject to the hospital with the utmost urgency
Inhalation	In case of exposure to high concentration of vapours take immediately to a non polluted zone the person involved

☞ **FIRE PREVENTION.** In case the working zone,for whatsoever cause goes on fire with flames liable to cause severe wounds or death, follow the first aid as described by the ruling norms or local ones.

EXTINCTION MEANS	
Appropriated	Carbonate anhydride (or carbon dioxyde) powder, foam, nebulized water
Not to be used	Avoid the use of water jets
Other indications	Cover eventual shedding not on fire with foam or sand, use water jets to cool off the surfaces close to the fire
Particular protection	Wear an autorespiratory mask when heavy smoke is present
Useful warnings	Avoid, by appropriate means to have oil sprays over metallic hot surfaces or over electric contacts (switches,plugs,etc.). In case of oil sprinkling from pressure circuits, keep in mind that the inflamability point is very low.

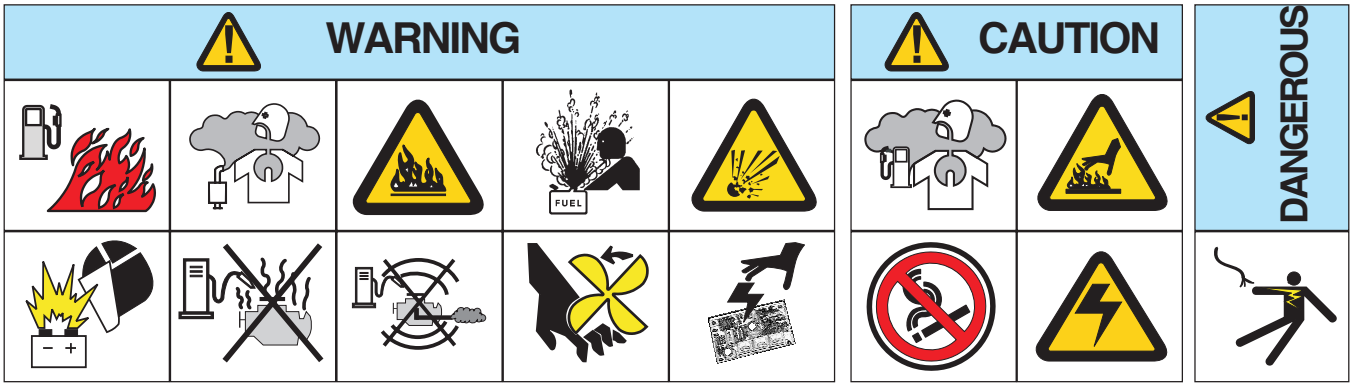

WARNING ***THE MACHINE MUST NOT BE USED IN AREAS WITH EXPLOSIVE ATMOSPHERE***

INSTALLATION AND ADVICE BEFORE USE

The operator of the welder is responsible for the security of the people who work with the welder and for those in the vicinity.
The security measures must satisfy the rules and regulations for engine driven welders.
The information given below is in addition to the local security norms.

Estimate possible electromagnetic problems in the work area taking into account the following indications.

1. Telephonic wirings and/or of communication, check wirings and so on, in the immediate vicinity.
2. Radio and television receptors and transmettors.
3. Computer and other checking devices.
4. Critical devices for safety and/or for industrial checks.
5. Peapol who, for instance, use pace-maker, hearing-aid for deaf or something and else.
6. Devices used for rating and measuring.
7. The immunity of other devices in the operation area of the welder. Make sure that other used devices are compatible. If it is the case, provide other additional measures of protection.
8. The daily duration of the welding time.

Make sure that the area is safe before starting any welding operation.

- Do not touch any bare wires, leads or contacts as they may be live and there is danger of electric shock which can cause death or serious burns. The electrode and welding cables, etc. are live when the unit is operating.
- Do not touch any electrical parts or the electrode while standing in water or with wet hands, feet or clothes.
- Insulate yourself from the work surface while welding. Use carpets or other insulating materials to avoid physical contact with the work surface and the floor.
- Always wear dry, insulating glovers, without holes, and body protection.
- Do not wind cables around the body.
- Use ear protections if the noise level is high.
- Keep flamable material away from the welding area.
- Do not weld on containers which contain flamable material.
- Do not weld near refuelling areas.
- Do not weld on easily flamable surfaces.
- Do not use the welder to defrost (thaw) pipes.
- Remove the electrode from the electrode holder, when not welding.
- Avoid inhaling fumes by providing a ventilation system or, if not possible, use an approved air breather.
- Do not work in closed areas where there is no fresh air flow.
- Protect face and eyes (protective mask with suitable dark lens and side screens), ears and body (non-flamable protective clothers).

INSTALLATION AND ADVICE BEFORE USE

GASOLINE ENGINES

☞ Use in open space, air swept or vent exhaust gases, which contain the deathly carbone oxyde, far from the work area.

DIESEL ENGINES

☞ Use in open space, air swept or vent exhaust gases far from the work area.

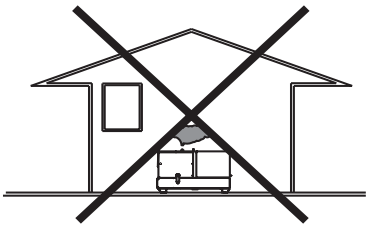

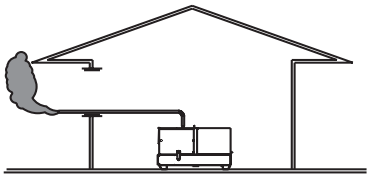

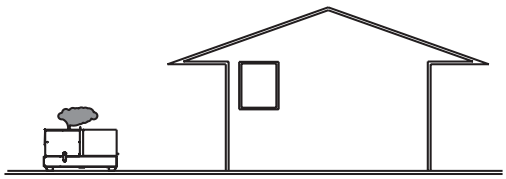

POSITION

Place the machine on a level surface at a distance of at least 1,5 m from buildings or other plants.

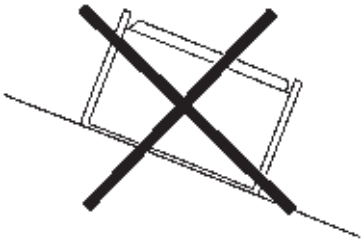

Maximum leaning of the machine (in case of dislevel)

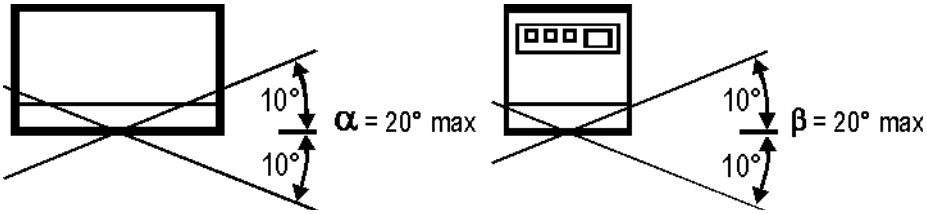

Check that the air gets changed completely and the hot air sent out does not come back inside the set so as to cause a dangerous increase of the temperature.

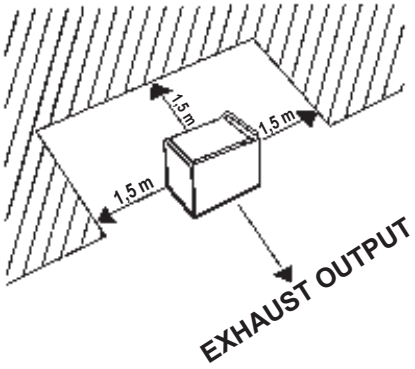

☞ Make sure that the machine does not move during the work: **block** it possibly with tools and/or devices made to this purpose.

MOVES OF THE MACHINE

☞ At any move check that the engine is **off**, that there are no connections with cables which impede the moves.

PLACE OF THE MACHINE

ATTENTION

For a safer use from the operator **DO NOT** fit the machine in locations with high risk of flood.
Please do not use the machine in weather conditions which are beyond IP protection shown both in the data plate and on page named "technical data" in this same manual.

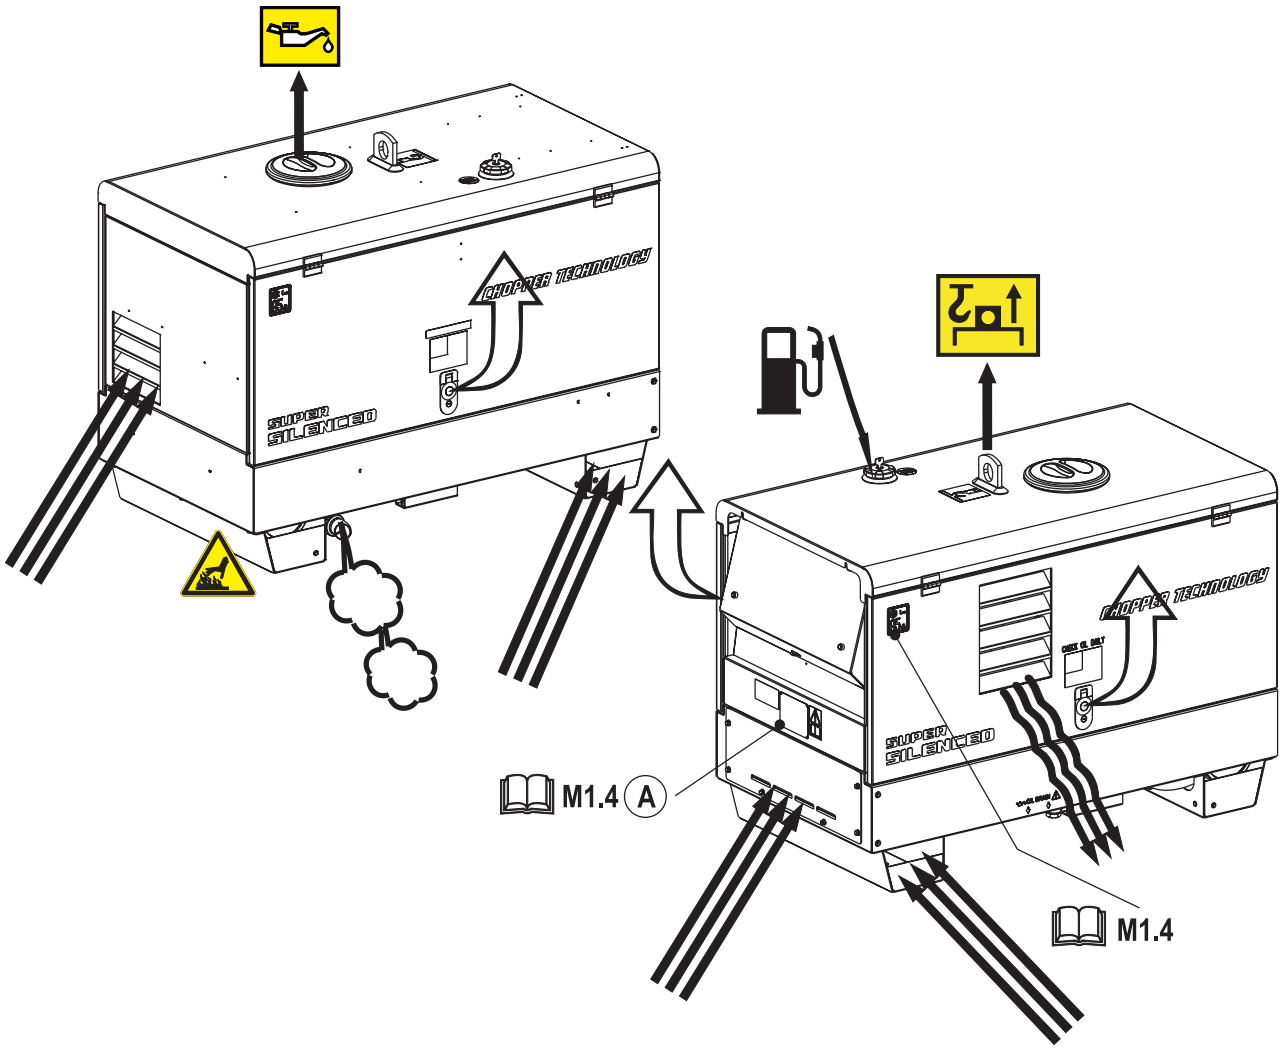
CHOPPER TECHNOLOGY
SUPER SILENCED
M1.4 A
M1.4

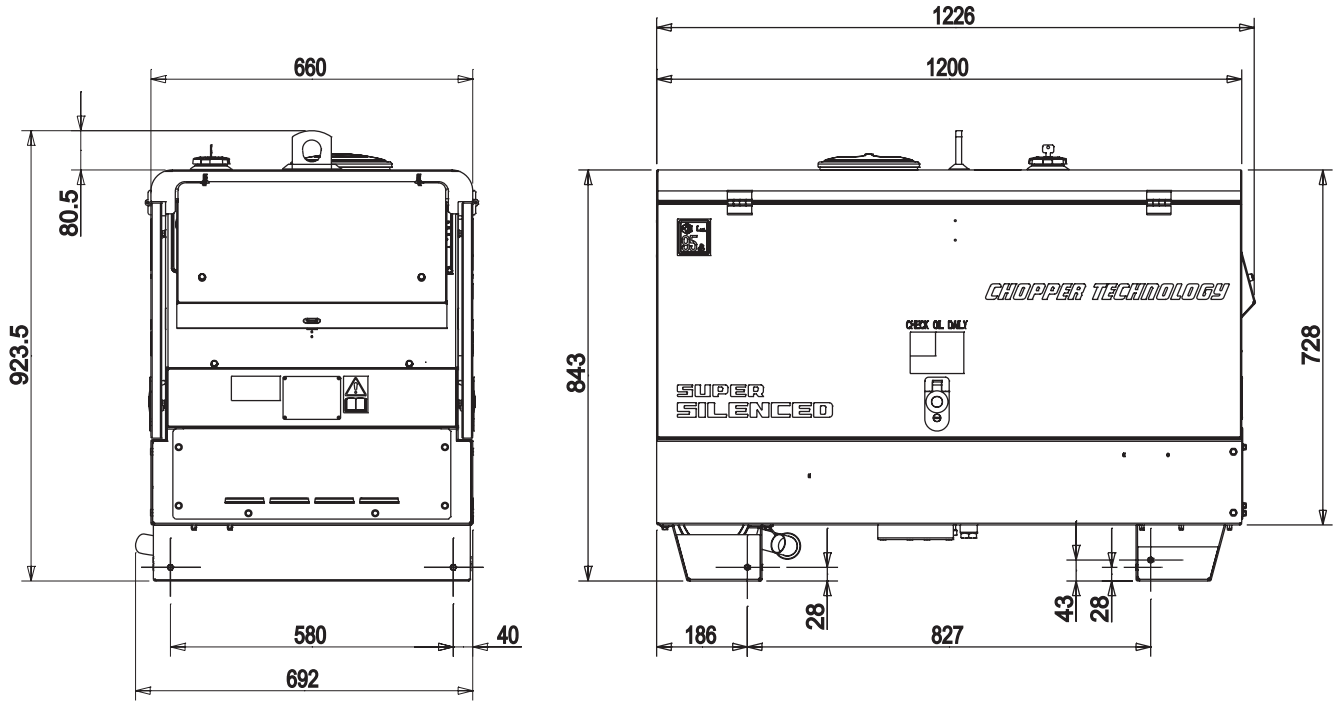
660
80.5
923.5
580
40
692
1226
1200
843
728
CHOPPER TECHNOLOGY
CHECK OIL DAILY
SUPER SILENCED
28
186
827
43
28

NOTE



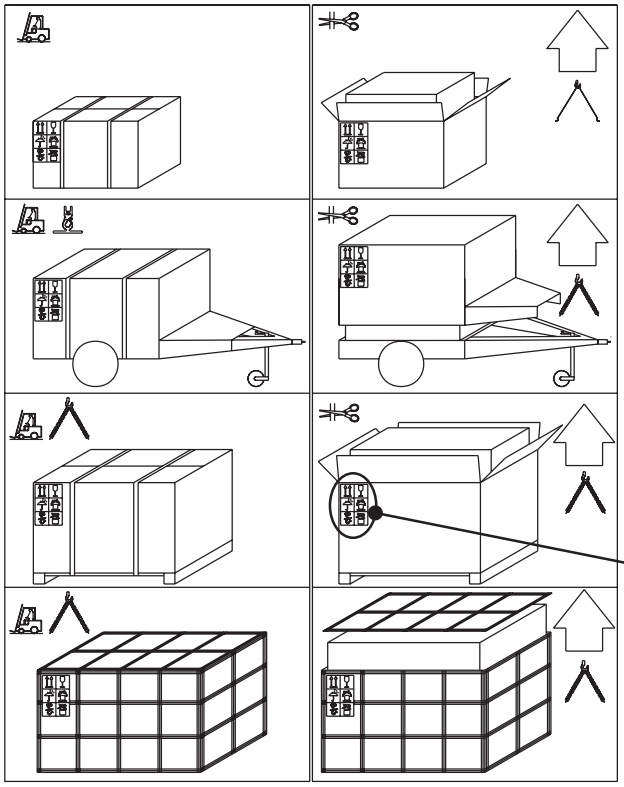

☞ Be sure that the lifting devices are: correctly mounted, adequate for the weight of the machine with it's packaging, and conforms to local rules and regulations.

When receiving the goods make sure that the product has not suffered damage during the transport, that there has not been rough handling or taking away of parts contained inside the packing or in the set.

In case you find damages, rough handling or absence of parts (envelopes, manuals, etc.), we advise you to inform immediately our Technical Service.

For eliminating the packing materials, the User must keep to the norms in force in his country.

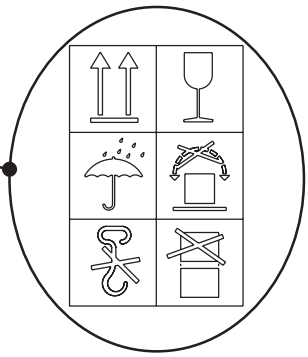

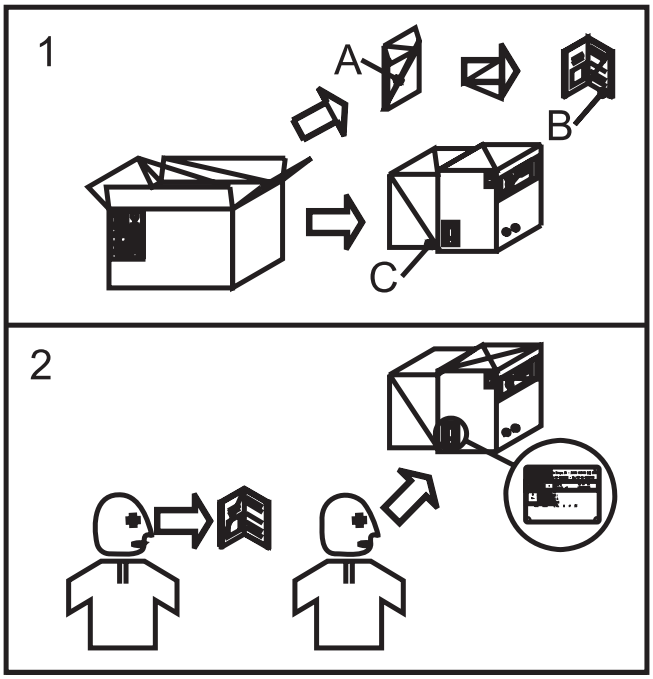

1) Take the machine (C) out of the shipment packing. Take out of the envelope (A) the user's manual (B).
2) Read: the user's manual (B), the plates fixed on the machine, the data plate.

NOTE

Transportation must always take place with the engine off, electrical cables and starting battery disconnected and fuel tank empty.
Be sure that the lifting devices are: correctly mounted, adequate for the weight of the machine with it's packaging, and conform to local rules and regulations.
Only authorized persons involved in the transport of the machine should be in the area of movement.

<u>DO NOT</u> LOAD OTHER PARTS WHICH CAN MODIFY WEIGHT AND BARICENTER POSITION.
IT IS STRICTLY <u>FORBIDDEN</u> TO DRAG THE MACHINE MANUALLY OR TOW IT BY ANY VEHICLE (model with no CTL accessory).
If you did not keep to the instructions, you could damage the structure of the machine.

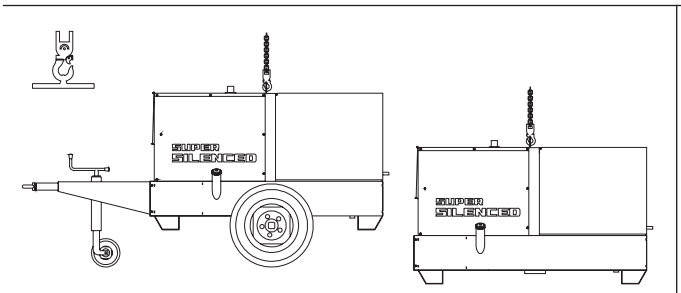

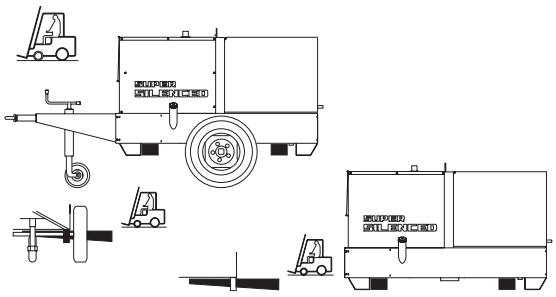

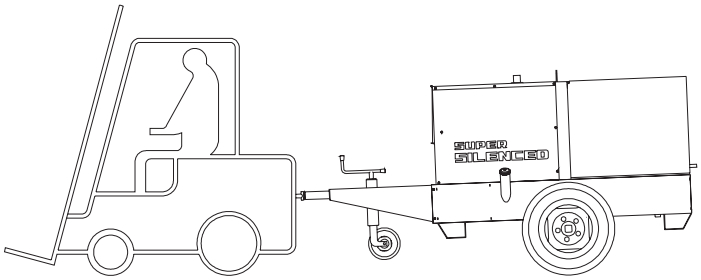

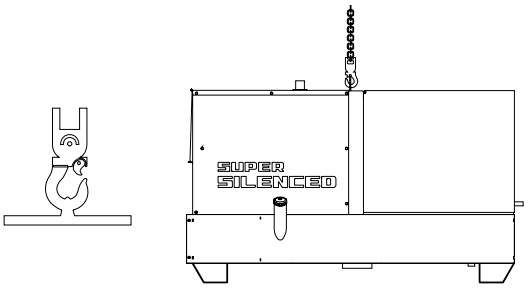

LIFT ONLY THE MACHINE

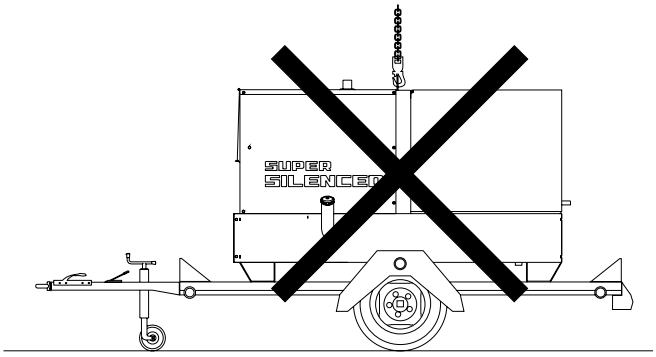

DO NOT LIFT THE MACHINE AND TRAILER

DANGER: LIFTING EYE IS NOT DESIGNED TO SUPPORT ADDED WEIGHT OF ROAD TOW TRAILER

NOTE

Transportation must always take place with the engine off, electrical cables and starting battery disconnected and fuel tank empty.
Be sure that the lifting devices are: correctly mounted, adequate for the weight of the machine with it's packaging, and conform to local rules and regulations.
Only authorized persons involved in the transport of the machine should be in the area of movement.

DO NOT LOAD OTHER PARTS WHICH CAN MODIFY WEIGHT AND BARICENTER POSITION.
IT IS STRICTLY FORBIDDEN TO DRAG THE MACHINE MANUALLY OR TOW IT BY ANY VEHICLE (model with no CTM accessory).
If you did not keep to the instructions, you could damage the structure of the machine.

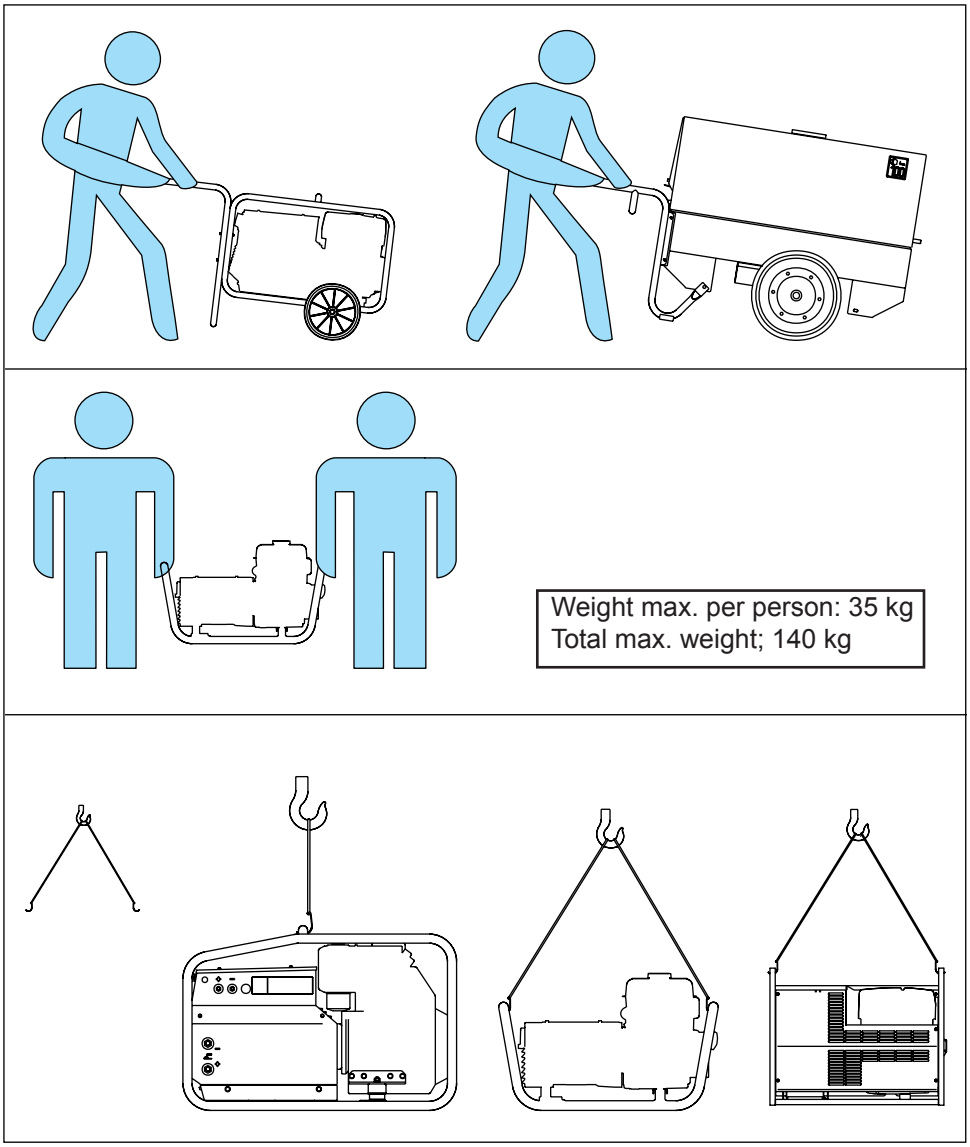

⚠ ATTENTION

The CTL accessory cannot be removed from the machine and used separately (actioned manually or following vehicles) for the transport of loads or anyway for used different from the machine movements.

TRAILERS

The machines provided for assembling the accessory (slow towing trolley) can be towed up to a **maximum** speed of **40 Kms/hour** on asphalted surfaces.

Towing on public roads or turnpikes of any type **IS EXCLUDED**, because **not** in possesion of the requirements by national and foreign traffic norms.

***Nota*:** Lift the machine and assemble the parts as shown in the drawing

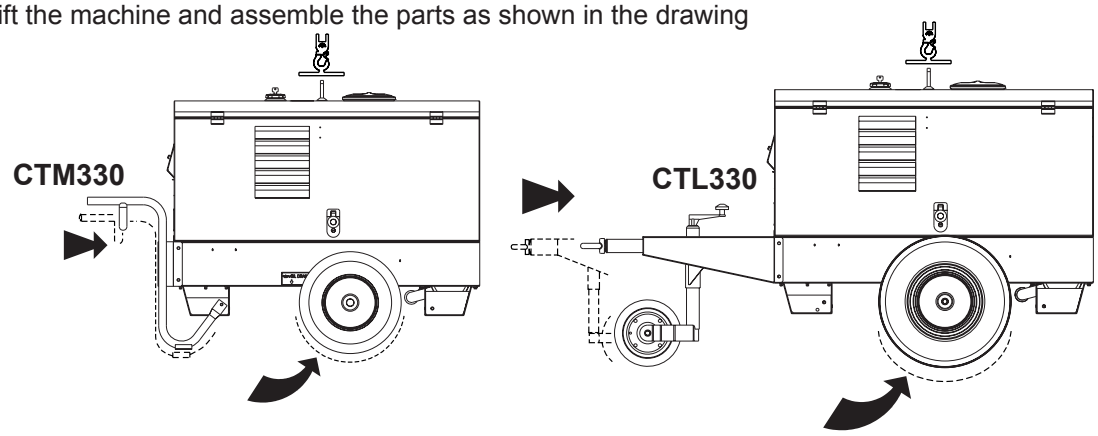

For assembling the generating set on the trolley CTL330 please keep to following instructions:

1) - Lift the generating set (by means of suitable hook).
2) - Slightly fix the jaw (3) of the parking foot to the barwith the M10x20 screws, the M10 nuts and the washers (so as to let the foot sprag go through).
3) - Split (unscrewing them) the two parts of the foot (4S-4I) to be able later to assemble them on the jaw.
4) - Introduce into the jaw (3) the upper part (4S) of the foot and screw again the lower part (4I), then tighten the screws (4V) of the jaw to the towbar and block momentaneously with the lever (4L) the whole foot.
5) - Assemble on the machine the towbar (5) complete of foot with the M10x20 screws, nuts and washers.
6) - Assemble the axle (7) to the base of the machine with the M8x20 screws and relative washers (two per part) so that their supports coincide.
7) - Introduce on the axle the antidust ring (7A) with folded edges turned toward the machine.
8) - Insert the wheel (9) on the axle paying attention to the spacer (8D) which is between the two bearings, then insert the self blocking nut (8A) and finally assemble the shutting cap (8C).
9) - Pump the tyre (9) bringing the pressure to three atms.
10) - Lower the machine to the ground and place the parking foot definitively (regulating at the best height).

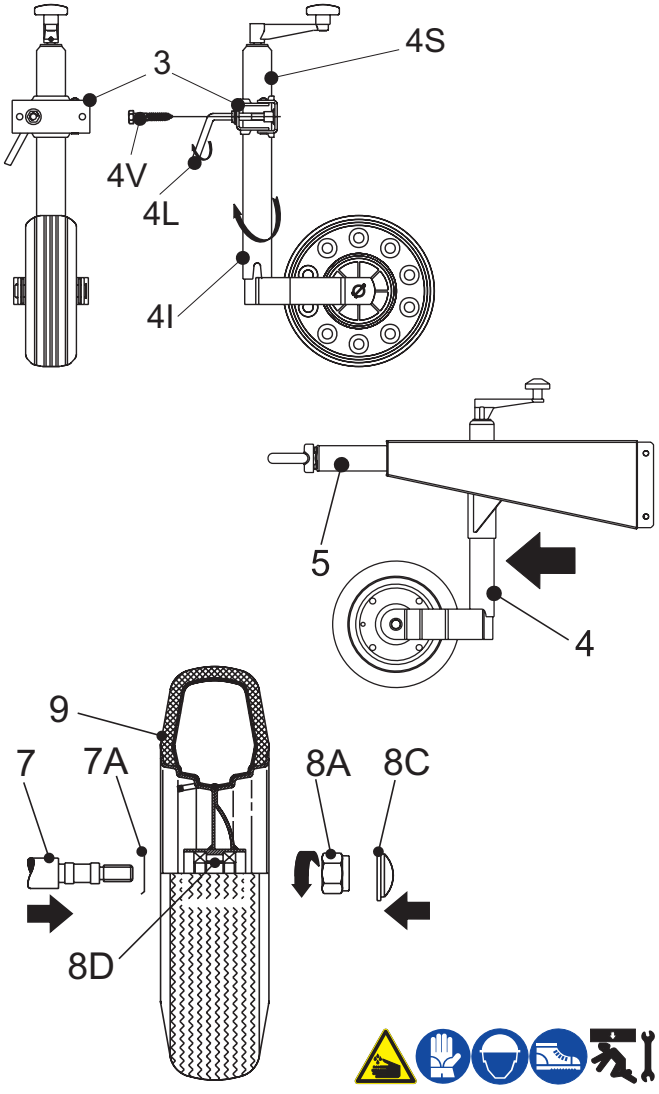

⚠ **ATTENTION**

Do not substitute the original tires with other types.

© MOSA 1.1-09/05

BATTERY WITHOUT MAINTENANCE

Connect the cable + (positive) to the pole + (positive) of the battery (after having taken away the protection), by properly tightening the clamp.

Check the state of the battery from the colour of the warning light which is in the upper part.

- Green colour: battery OK
- Black colour: battery to be recharged
- White colour: battery to be replaced

DO NOT OPEN THE BATTERY.

LUBRICANT

RECOMMENDED OIL

MOSA recommends selecting **AGIP** engine oil. Refer to the label on the motor for the recommended products.

PRODOTTI RACCOMANDATI RECOMMENDED PRODUCTS	
AGIP SIGMA TURBO PLUS 15W/40 API CG4 - ACEA E3	OLIO MOTORE DIESEL DIESEL ENGINE OIL
AGIP SUPERMOTOROIL 20W/50 API CC-SF	OLIO MOTORE BENZINA GASOLINE ENGINE OIL
AGIP ANTIFREEZE EXTRA INIBITE ETHYLENE GLYCOL (50% + 50% + H_2O)	CIRCUITO DI RAFFREDDAMENTO COOLING CIRCUIT (CUNA NC 956-16 ED 97)

Please refer to the motor operating manual for the recommended viscosity.

REFUELLING AND CONTROL:

Carry out refuelling and controls with motor at level position.

1. Remove the oil-fill tap (24)
2. Pour oil and replace the tap
3. Check the oil level using the dipstick (23); the oil level must be comprised between the minimum and maximum indicators.

ATTENTION

It is dangerous to fill the motor with too much oil, as its combustion can provoke a sudden increase in rotation speed.

DRY AIR FILTER

Check that the dry air filter is correctly installed and that there are no leaks around the filter which could lead to infiltrations of non-filtered air to the inside of the motor.

OIL BATH AIR FILTER

Fill the air filter using the same engine oil up to the level indicated on the filter.

FUEL

ATTENTION

Do not smoke or use open flames during refuelling operations, in order to avoid explosions or fire hazards.
Fuel fumes are highly toxic; carry out operations outdoors only, or in a well-ventilated environment.

Avoid accidentally spilling fuel. Clean any eventual leaks before starting up motor.

Refill the tank with good quality diesel fuel, such as automobile type diesel fuel, for example.

For further details on the type of diesel fuel to use, see the motor operating manual supplied.

Do not fill the tank completely; leave a space of approx. 10 mm between the fuel level and the wall of the tank to allow for expansion.

In rigid environmental temperature conditions, use special winterized diesel fuels or specific additives in order to avoid the formation of paraffin.

GROUNDING CONNECTION

The grounding connection to an earthed installation **is obligatory** for all models equipped with a differential switch (circuit breaker). In these groups the generator star point is generally connected to the machine's earthing; by employing the TN or TT distribution system, the differential switch guarantees protection against indirect contacts.
In the case of powering complex installations requiring or employing additional electrical protection devices, the coordination between the protection devices must be verified.
For the grounding connection, use the terminal (12); comply to local and/or current regulations in force for electrical installations and safety.

Check daily

NOTE

Do not alter the primary conditions of regulation and do not touch the sealed parts.

ATTENTION

1. By start-up of the generator the welding circuit is immediately operative, i.e. under voltage. Make sure that there are no unwished electrical contacts between the components of the outside welding circuit (electrode, electrode holder gun, workpiece, etc…).

2. Check that at the start-up the a.c. auxiliary generation sockets do not feed any load. Open the electric protection interrupter of the generator or disconnect the plugs of the loads from the sockets.

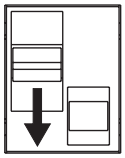



3. START-UP

Remember that when the machines with auto-idle have the signal set to “auto-idle” will remain at the minimum no. of revs (tickover) as long as no current is drawn.

Drawing power will automatically raise the number of engine revs to the nominal value and likewise the tension in the alternator.

Instead, by setting the auto-idle signal to “max”, the engine revs will immediately rise to the nominal value and likewise the tension in the alternator.

For the machines with manual accelerator, it is necessary to accelerate the motor manually in order to reach the nominal tension.

Starting is actuated using the key which is an integral part of the EP7 post on the front panel.

A) - Turn the key in a clockwise direction until all the LED lights are illuminated.

B) - Wait until the “OIL PRESSURE” and “BATTERY VOLTAGE” LEDs remain illuminated. If the timer lamp is used, the yellow “PREHEAT” LED comes on for the set time of the imposed settings.

C) - As soon as the green “ENGINE RUNNING” LED starts to flash, actuate the key switch in a clockwise direction (momentarily in the position then with return to rest) until obtaining starting of the engine.

If the motor does not start within 15 seconds, the non starting alert will intervene: the two LEDs “Engine running” and “glow plug” will flash alternately (see motor protection description).

D) - At any time it is possible to stop the engine by turning the key in an anti-clockwise direction (OFF position).

In case of engine anomaly due to low oil pressure, high temperature, broken transmission belt, low fuel level or emergency the EP7 will automatically stop the engine.

4. The motor starts up at its operating speed, 3000 rpm. After start-up, allow the motor to run for a few minutes before powering on the utilities. See table;

Temperature	Time
≤ - 20° C	5 min.
da - 20° C a -10°C	2 min.
da - 10° C a -5°C	1 min.
≥ 5° C	20 sec.

5. start-up at low temperatures.

The motor will normally start up without problems down to temperatures of -10° C, -15° C. In case of starting difficulty, it is possible to repeat the starting preheating for a max. time of 10 second, lightly turning the trimmer situated at the back of the EP7 in a clockwise direction (see page M39.13 relating to engine protection “trimmer/glow plug”). For start-up and use at lower temperatures please see the engine manual or turn to our Technical Assistance Center.

☞ ***In case of unsuccessful start-up, do not insist for longer than 5 seconds. Wait 10 - 15 seconds before attempting another start-up.***

CAUTION

RUNNING-IN

During the first 50 hours of operation, do not use more than 60% of the maximum output power of the unit and check the oil level frequently, in any case please stick to the rules given in the engine use manual.

STOP

For shutdown under normal conditions, proceed as follows:

1. Break the welding process in course

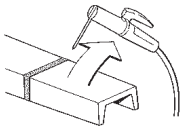

2. Break the production of a.c. auxiliary generation dividing the loads or opening the GFI (D).

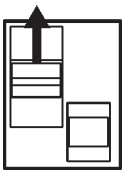

3. Let the engine run with no load for a few minutes. Set the engine speed to minimum, signal of motor speed to “auto-idle”, or accelerator to minimum for manual accelerator.

4. Turn the start key on the EP7 to the OFF position.

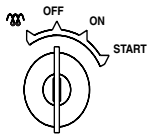

EMERGENCY SHUTDOWN

To stop the group in a dangerous situation, press the emergency stop button (L5) (or turn the start key (Q1) to the OFF position). To reset the knob, turn it clockwise.

4A Hydraulic oil level light
9 Welding socket (+)
10 Welding socket (-)
12 Earth terminal
15 A.C. socket
16 Accelerator lever
17 Feed pump
19 48V D.C. socket
22 Engine air filter
23 Oil level dipstick
24 Engine oil reservoir cap
24A Hydraulic oil reservoir cap
24B Water filling cap
25 Fuel prefilter
26 Fuel tank cap
27 Muffler
28 Stop control
29 Engine protection cover
30 Engine cooling/alternator fan belt
31 Oil drain tap
31A Hydraulic oil drain tap
31B Water drain tap
31C Exhaust tap for tank fuel
32 Button
33 Start button
34 Booster socket 12V
34A Booster socket 24V
35 Battery charge fuse
36 Space for remote control
37 Remote control
42 Space for E.A.S.
42A Space for PAC
47 Fuel pump
49 Electric start socket
54 Reset button PTO HI
55 Quick coupling m. PTO HI
55A Quick coupling f. PTO HI
56 Hydraulic oil filter
59 Battery charger thermal switch
59A Engine thermal switch
59B Aux current thermal switch
59C Supply thermal switch wire feeder-42V
59D Pre-heater (spark plug) thermal switch
59E Supply thermal switch oil/water heather
59F Electropump thermal switch
63 No load voltage control
66 Choke control
67A Auxiliary / welding current control
68 Cellulosic electrodes control
69A Voltmeter relay
70 Warning lights
71 Selecting knob
72 Load commut. push button
73 Starting push button
74 Operating mode selector
75 Power on warning light
76 Display
79 Wire connection unit
86 Selector
86A Setting confirmation
87 Fuel valve
88 Oil syringe
A3 Insulation monitoring
A4 Button indicating light 30 l/1' PTO HI
B2 Engine control unit EP2
B3 E.A.S. connector
B4 Exclusion indicating light PTO HI
B5 Auxiliary current push button
C2 Fuel level light
C3 E.A.S. PCB
C6 Control unit for generating sets QEA
D Ground fault interrupter (30 mA)
D1 Engine control unit and economiser EP1
D2 Ammeter
E2 Frequency meter
F Fuse
F3 Stop switch
F5 Warning light, high temperature
F6 Arc-Force selector
G1 Fuel level transmitter
H2 Voltage commutator
H6 Fuel electro pump
H8 Engine control unit EP7
I2 48V A.C. socket
I3 Welding scale switch
I4 Preheating indicator
I5 Y/▲ switch
I6 Start Local/Remote selector
I8 AUTOIDLE switch
L A.C. output indicator
L5 Emergency button
L6 Choke button
M Hour counter
M1 Warning level light
M2 Contactor
M5 Engine control unit EP5
M6 CC/CV switch
N Voltmeter
N1 Battery charge warning light
N2 Thermal-magnetic circuit breaker/ Ground fault interrupter
N5 Pre-heat push-button
N6 Connector - wire feader
O1 Oil pressure warning light/Oil alert
P Welding arc regulator
Q1 Starter key
Q3 Derivation box
Q4 Battery charge sockets
Q7 Welding selector mode
R3 Siren
S Welding ammeter
S1 Battery
S3 Engine control unit EP4
S6 Wire feeder supply switch
S7 Plug 230V singlephase
T Welding current regulator
T4 Dirty air filter warning light/indicator
T5 Earth leakage relay
T7 Analogic instrument V/Hz
U Current trasformer
U3 R.P.M. adjuster
U4 Polarity inverter remote control
U5 Relase coil
U7 Engine control unit EP6
V Welding voltage voltmeter
V4 Polarity inverter control
V5 Oil pressure indicator
W1 Remote control switch
W3 Selection push button 30 l/1' PTO HI
W5 Battery voltmeter
X1 Remote control socket
Y3 Button indicating light 20 l/1' PTO HI
Y5 Commutator/switch, serial/parallel
Z2 Thermal-magnetic circuit breaker
Z3 Selection push button 20 l/1' PTO HI
Z5 Water temperature indicator

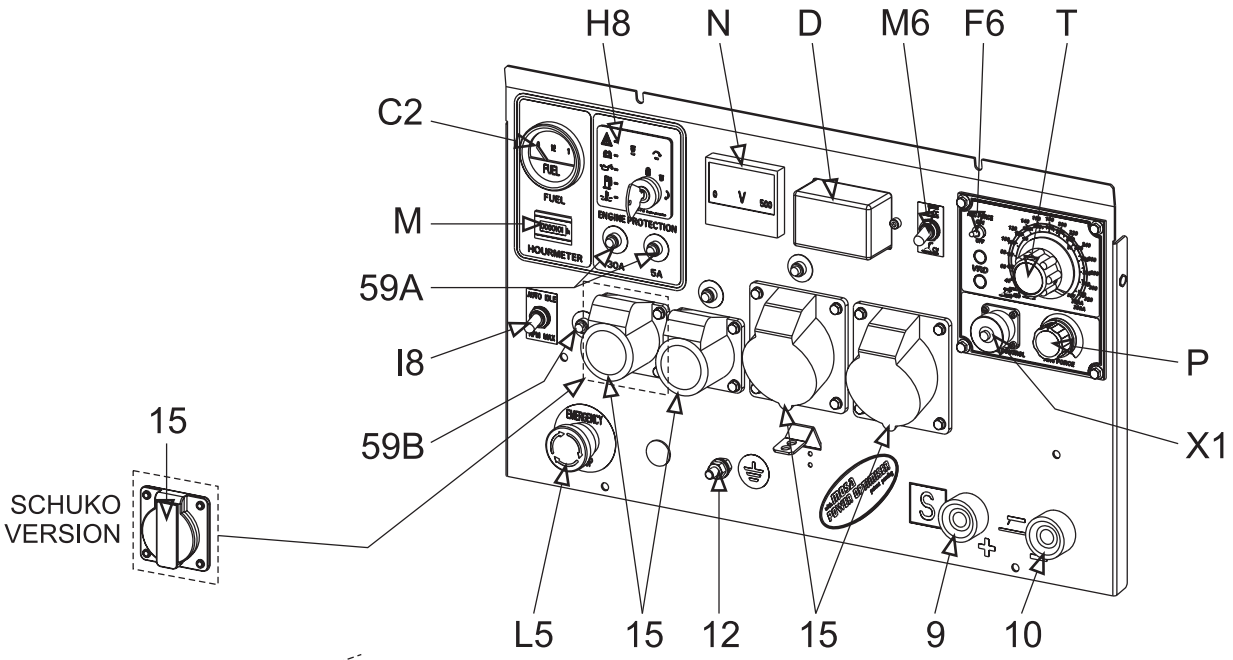
H8
N
D
M6
F6
T
C2
M
59A
I8
59B
15
SCHUKO
VERSION
P
X1
L5
15
12
15
9
10

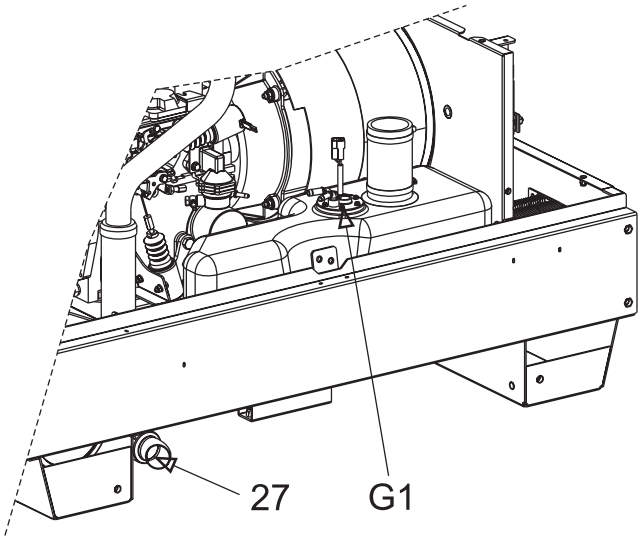
27
G1

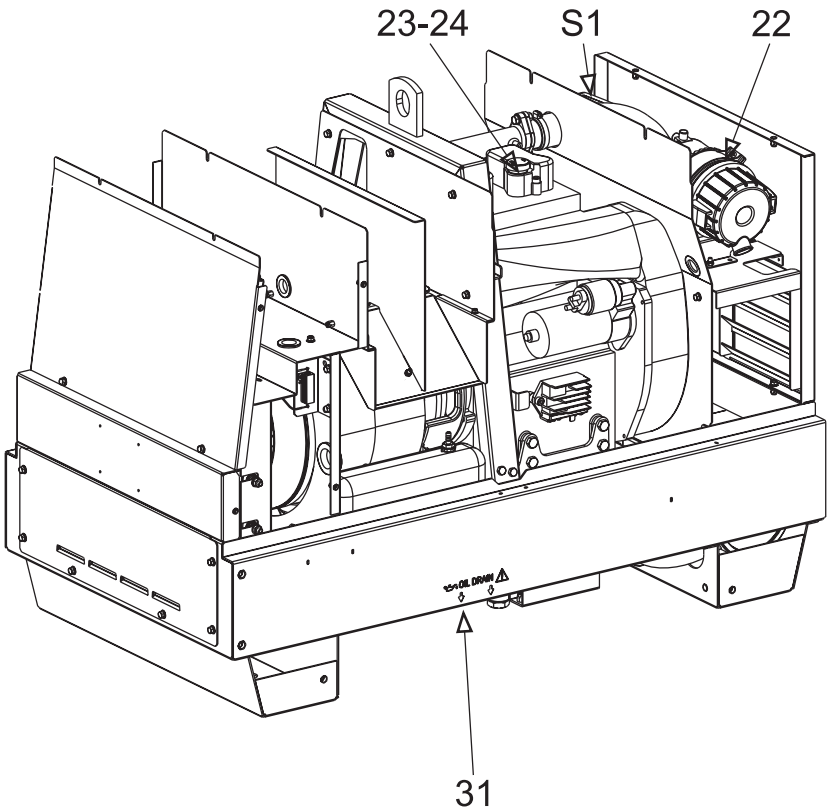
23-24
S1
22
31

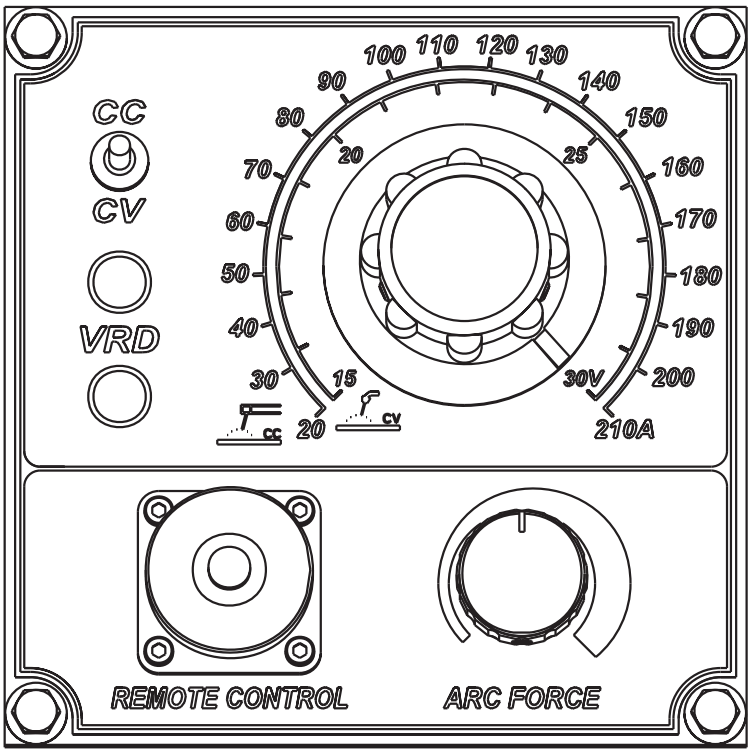

WELDING MODE SELECTION

Two welding modes can be selected by setting accordingly the mode switch on the Control Panel:
Constant Current (CC) or
Constant Voltage (CV).
CC is used for various types of electrode welding
CV is used for wire welding. All wire type welding processes can be carried out, naked or coated.

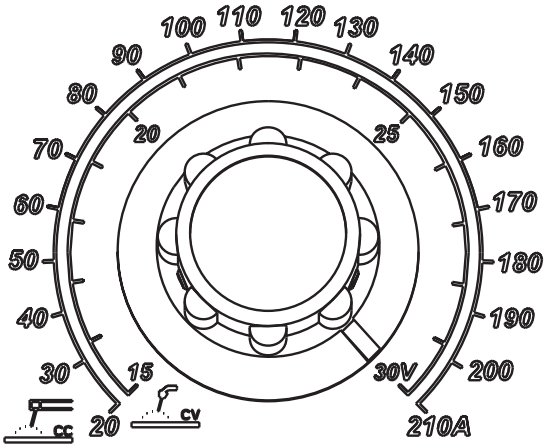

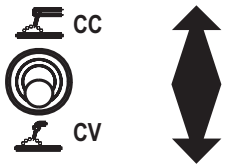

CC (constant current) - electrodes

CV (constant voltage) - wire

ARC FORCE REGULATION

Different levels of “arc force” can be featured by adjusting the arc force knob, thereby changing the arc penetration according to the electrode used and/or welding position.

WELDING CURRENT / VOLTAGE REGULATION

Current regulation – When the CC/CV switch is in CC position, the main potentiometer regulates the welding current within the range 20 – 210A.
Voltage regulation – With the CC/CV switch in CV position the main potentiometer regulates the welding voltage within the range 15 – 30V.

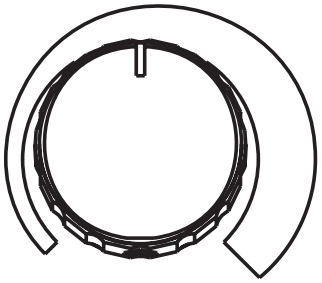

OPTIONAL REMOTE CONTROL

The welding current can also be set from a distance using the optional remote control. Once the remote control is connected to the connector (X1), the current is controlled by the remote control. To return to front panel control remove the connector.

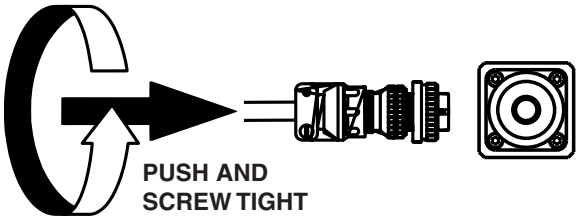

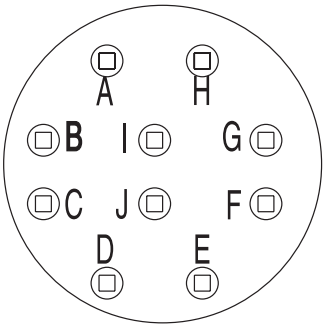

CONTACT	DESCRIPTION
A	Remote potentiometer - GND
B	Remote potentiometer - cursor
C	Remote potentiometer - 5V ref. voltage
D	Remote Control presence (jumper between C and D at RC side)
E	Unused
F	5V reference voltage
G	Welding enable from wire feeder - switched ac phase A from welding gun
H	Welding negative voltage for remote voltmeter on wire feeder
I	44Vac phase A for wire feeder supply
J	44Vac phase B for wire feeder supply

OPTIONAL VRD FEATURE (VRD = Voltage Reduction Device)

Each time the welding process is interrupted for more than 3 seconds, the VRD feature is activated. When the welding machine is in VRD mode, the voltage at the welding sockets is kept below a safety value (typically the voltage is around 11V).
When starting to weld the machine automatically exits the VRD mode.
The status "VRD in" / "VRD out" is checked by a voltage monitor and indicated by a green led and a red led respectively. When the welding voltage is below 13V, i.e. the VRD is active, the green led is on and the red one is off, indicating a safe condition.
During a welding process, when the voltage normally exceeds 14V, the green light is off and the red one is on, indicating the presence of a potentially dangerous voltage at the welding sockets.

This symbol (Norm EN 60974-1 security standards for arc welders) signifies that the welder can be used in areas with increased risk of electrical shock.

ATTENTION

The welding sockets, after the machine is started (see page M 21), also with no cables, are anyway under voltage.

ATTENTION

The areas, access of which is forbiden to unqualified personel, are:

- the control switchboard (front) - the exhaust of the endothermic engine - the welding process.

Check at the beginning of any work the electric parameters and/or the control placed on the front.

Make sure that the ground connection (12) is efficent (when this connection is present, being necessary). See page M20.

Fully insert the welding cable plugs into the corresponding sockets turning them clockwise to lock them in position.

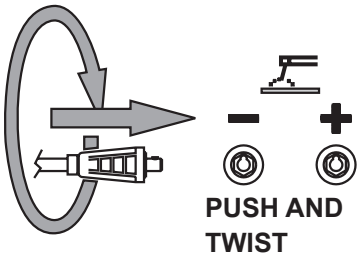

☞ Make sure that the ground clamp, whose cable must be connected to the + or - terminal, depending on the type of electrode, makes a good connection and is near to the welding position. Pay attention to the two polarities of the welding circuit, which must not come in electric contact between themselves

REMOTE CONTROL

See page M 38

ATTENTION

To reduce the risk of electromagnetic interferences, use the minimum lenght of welding cables and keep them near and down (ex. on the floor).

The welding operations must take place far from any sensitive electronic device.Make sure that the unit is earthed (see M20). In case the interference should last, adapt further disposition, such as: move the unit, use screened cables, line filters, screen the entire work area.

In case the above mentioned operations are non sufficient, please contact our Technical Assistance Service.

CAUTION

With a welding cable length up to 20 m is suggested a section of 35 mm²; with longer cables a bigger section is required.

WARNING

It is strictly forbidden to connect the group to the public mains and/or to any other source of electric power.

GENERATION IN AC (ALTERNATING CURRENT)

Make certain of the efficiency of the ground connection (12). - See page M20 -.

Position the GFI switch to ON.

☞Voltage is now immediately available to the AC sockets.

Verify that the voltmeter displays the nominal voltage value (at no load it is close to +10% of the nominal value).

Connect the electric devices to be powered to the AC sockets, using suitable plugs and cables in good condition.

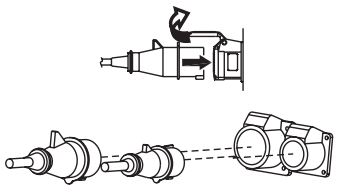

☞ Verify that the electrical characteristics (voltage/frequency/power) of the device being powered are compatible with those of the generator.
Low frequency and/or voltage can irreparably damage some electrical devices.

Verify that the ground lead of the electrical appliance/tool to be powered is correctly connected to the terminal of the plug.

☞ For double insulation devices with the symbol ⧈ , the plug's ground terminal does not need to be grounded.

THERMAL PROTECTION

The monophase outputs are protected against overloads by the thermal protection (59B).

When the rated current is exceeded, the protection intervenes to cut off the voltage to the AC socket.

☞ **Notes:** the intervention of the thermal protection is not instantaneous, but reacts according to an overcurrent/time characteristic, whereby the greater the overcurrent the quicker the intervention.

In case of intervention by the protection device, verify that the total power for the loads connected does not exceed the declared rating and decrease if necessary. Disconnect the loads and wait a few minutes to allow the thermal protection to cool down.

Before resetting by pressing the central button and then connect the load again.

If the protection should intervene again, replace it with another one with matching intervention current specifications and/or contact the Service Department.

. Note: do not forcibly hold the central button of the thermal protection device to prevent its intervention, as this could irreparably **damage** the unit's alternator.

☞ Note: the three phase output does not require any protection against overcurrents, since it uses a self-protecting asynchronous type alternator.

GROUND FAULT INTERRUPTOR SWITCH

The high-sensitivity ground fault interruptor switch [G.F.I.] (30mA) (D), guarantees protection against indirect contacts due to faulty ground currents .

When the G.F.I. switch picks up a faulty ground current that is higher than 30mA, it intervenes by immediately cutting off voltage to the AC sockets.

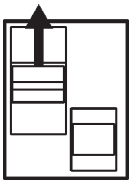

In case of intervention by this protection device, reset the G.F.I. switch by moving the lever to the ON position. In case of another intervention, verify that there are no faults in the tools connected, or replace the G.F.I. switch with another one of matching specifications and/or contact the Service Department.

☞ **Notes:** Verify the operation of the G.F.I. switch at least once a month by pressing the TEST button. The generator must be running and the G.F.I. lever in the ON position.

SIMULTANEOUS USE

The welder's alternator permits the simultaneous use of auxiliary power and welding current. The auxiliary power available to the AC plugs (15) diminishes as the welding current drawn increases.

The table on page M1.6 TECHNICAL SPECIFICATIONS shows the amount of auxiliary power available as the welding current varies.

COMBINED USE

The output available from the various auxiliary power sockets is limited, not only by the declared output of the unit but also by the capacity of each individual socket.

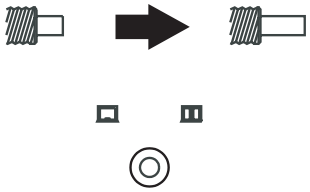

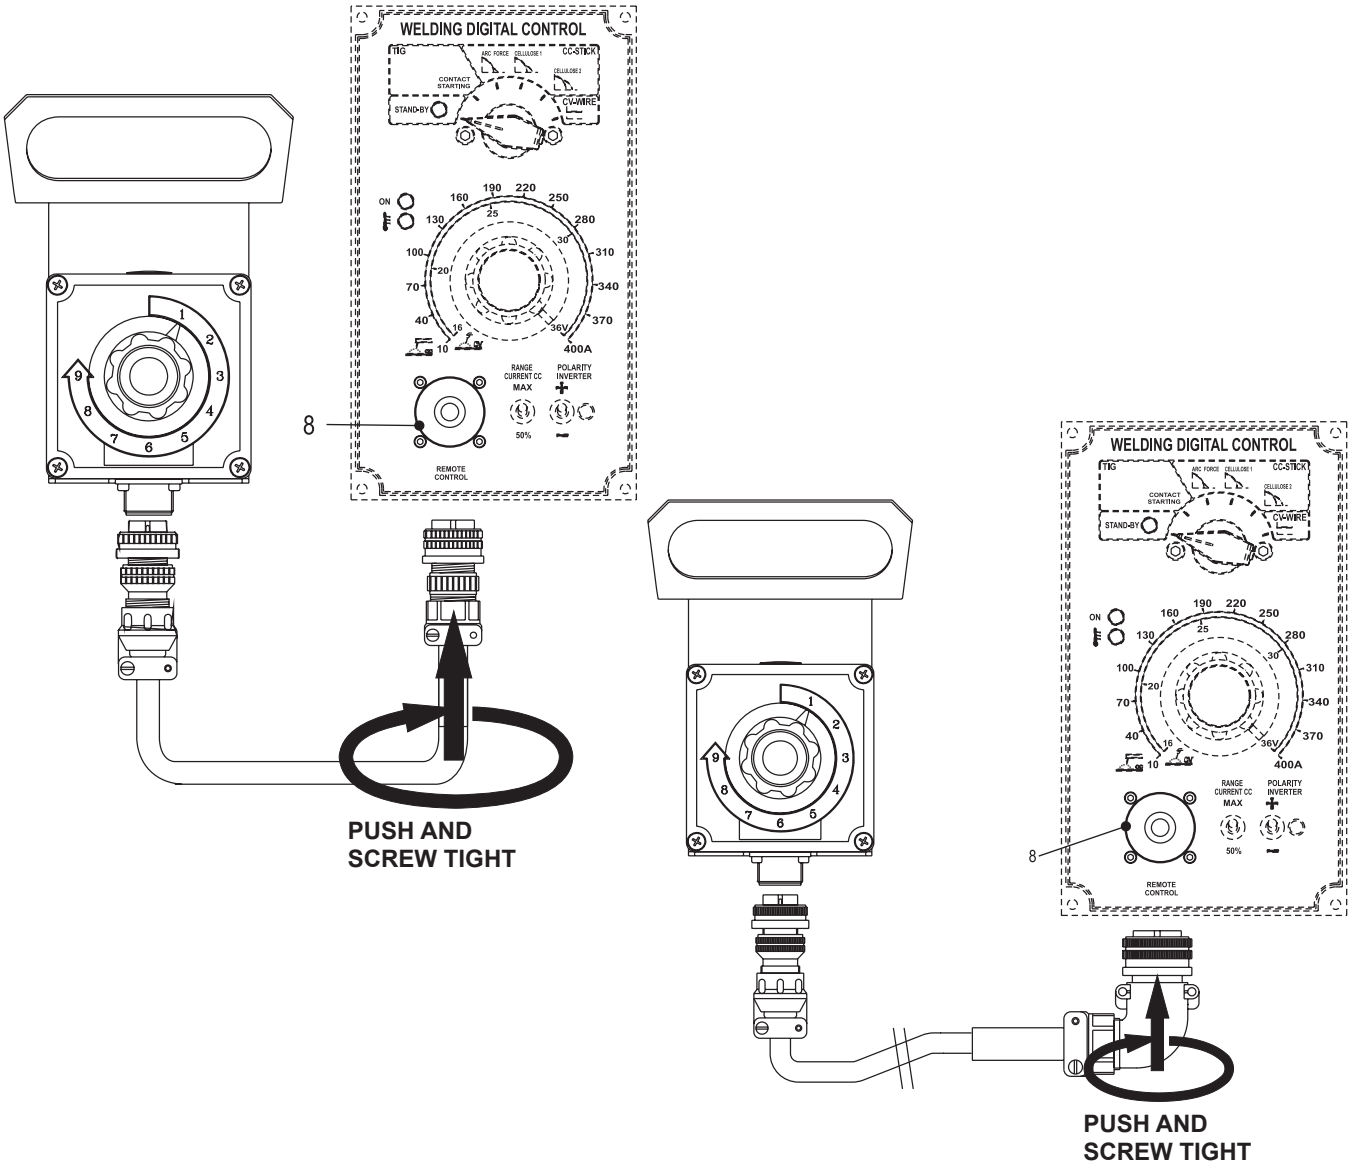

The remote control RC, which regulates the welding current in the CC (STICK welding) mode and the welding voltage in the CV (MIG/MAG welding), is connected to the front panel by means of a multipole connector.

When the remote control is connected to the remote control connector (8), it is functional and automatically excludes the front panel regulation. The remote control can also be connected to the connector on the wire feeder front panel but in this case it is necessary to switch the wire feeder commutator so it can operate.

Adjust the welding current control knob to the correct current for the diameter and type of electrode being welded.

ATTENTION

When the RC is not used, it is necessary to disconnect the multipole connector

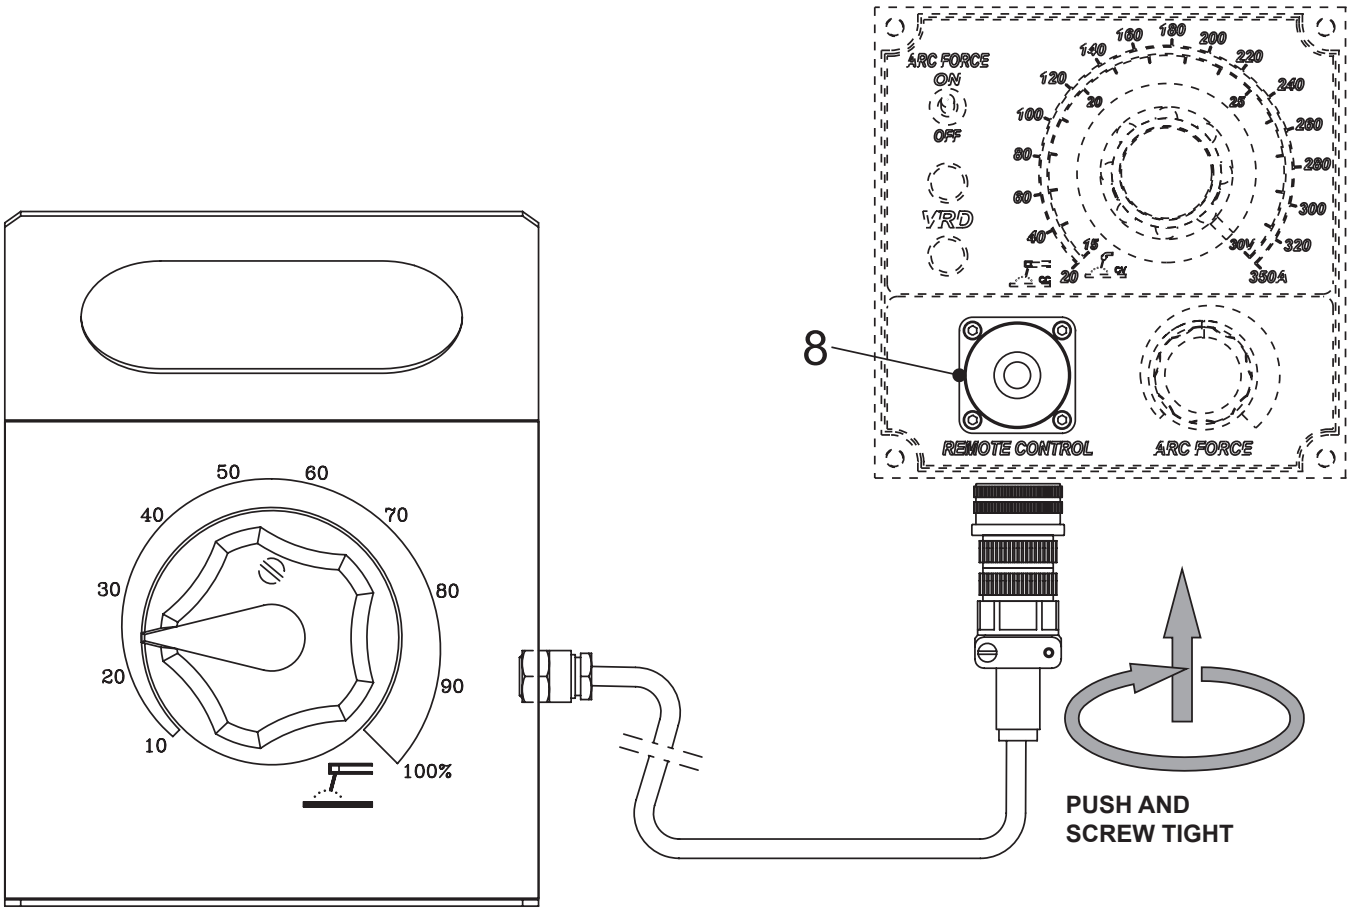

The remote control device for regulating the welding current is connected to the front panel by means of a multipole connector.

When the remote control is connected to the remote control connector (8), it is functional and automatically excludes the front panel regulation.

Position welding current adjusting (T) knob at the necessary current value for the diameter and type of electrode.

Description

The EP7 includes the basic safeguards to protect an DIESEL engine. The EP7 features 7 LEDs, 3 Static Outputs and a 30A Key Switch. The EP7 monitors an Oil Pressure-switch, Temperature-switch, Fuel Level-switch, Charger Alternator Voltage, and an Emergency-switch.

Specification

DC Supply, Battery Plant	8V up to 36 Vdc
Static Outputs (short circuit proof)	200 mAdc
Key Switch Rating	30 A (30 secs)/80 A (5 secs)
Dimensions-DIN 96 Size	72X72X55 (ex switch /key)
Weight	300 gr
Operating Temperature	-30° C /+70° C
Operating Humidity	96% (non-condensing)

[ENGINE RUNNING] green LED
This LED blinks for 15 seconds, indicating that the EP7 is ready to start the engine (you have to turn the key to start). If the engine does not run within 15 seconds, the "Starting Failure" alarm will take place. This LED illuminates continuously if the engine runs.

[PREHEAT] yellow LED
This indicator illuminates during the Pre-Glow cycle (10 secs to 60 secs).

[EMERGENCY] red LED
This LED illuminates continuously when a shut down has been caused by the Emergency switch.

[ALTERNATOR FAILURE] red LED
This LED illuminates before engine starting or if a Belt Break shut down occurs (than 20 secs).

[OIL PRESSURE] red LED
This LED illuminates before engine starting or if an Oil Pressure shut down occurs.

[FUEL LEVEL] red LED
This LED blinks when a low fuel condition occurs.
This LED illuminates continuously to indicate a shut down, if the switch has been closed for more than 5 minutes.

[TEMPERATURE] red LED
This LED illuminates when an High Temperature shut down occurs.

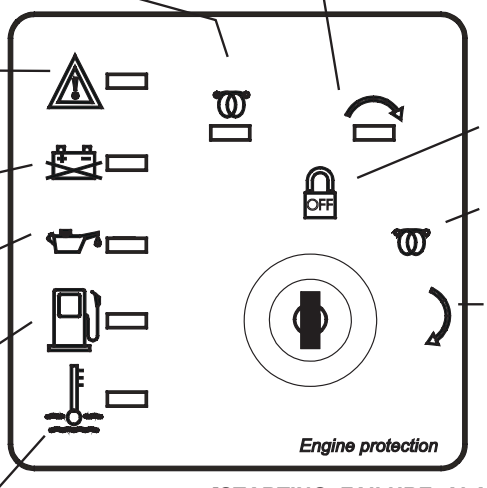

[KEY-SWITCH] OFF position

[KEY-SWITCH] Pre-Heat position

[KEY-SWITCH] START position

[STARTING FAILURE ALARM] indication
These 2 LEDs blink alternatevely (slowly) to indicate a starting failure alarm.

[OPTIONAL ALARM] indication
These 2 LEDs blink alternatevely (quickly) to indicate the intervention of the alarm.

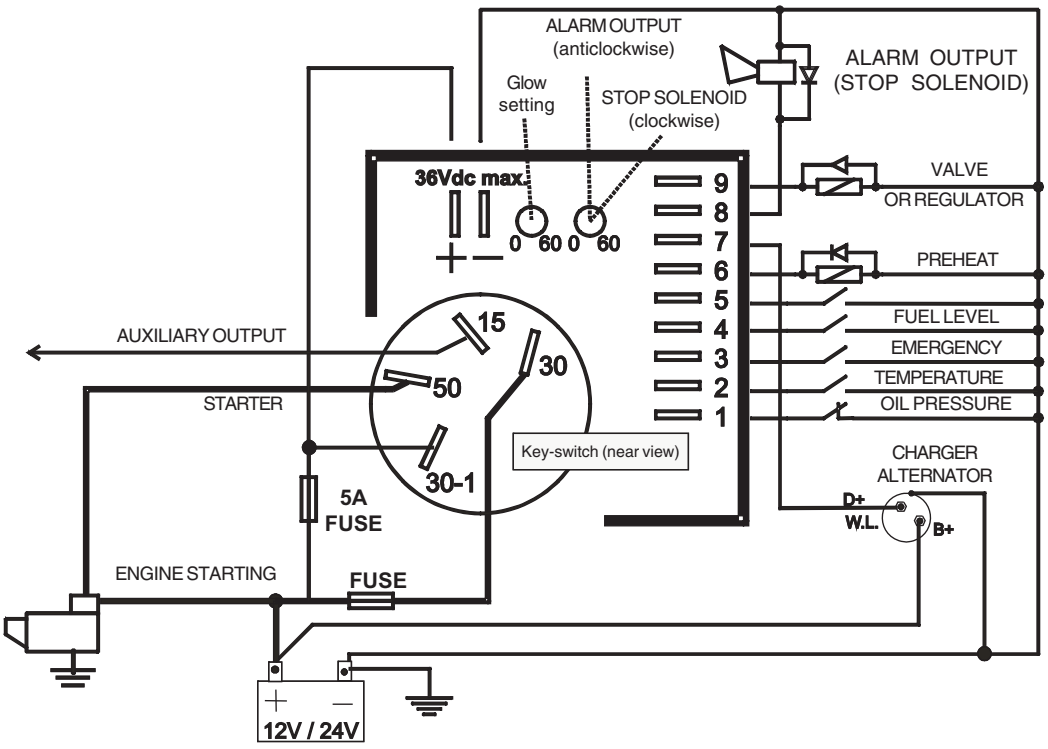

07/05/01 M39GB

PROBLEM	ASSOCIATED SYMPTOMS	POSSIBLE CAUSE	VERIFICATIONS	WHAT TO DO
P1 No welding arc **(applicable only to machines with WAC)**	No open circuit voltage	Failed power supply within the welding control board (WAC)	With the machine running, by means of a multimeter, check if there is a voltage of 5VDC ± 0,125V between the contacts A (-) and C (+) on the circular connector of the WAC. In case of lack of voltage or condition not satisfied consider the suggested action.	Replace the welding control board of the WAC
P2 No welding arc **(applicable only to machines without WAC)**	No open circuit voltage	Failed power supply within the welding control board (WAC)	With the machine running, by means of a multimeter, check if there is a voltage of 5VDC ± 0,125V between the contacts 1 (-) and 2 (+) on the circular connector of the front panel, after having set the remote control switch in ON position. In case of lack of voltage or condition not satisfied consider the suggested action.	Replace the welding control board
P3 No welding arc	No open circuit voltage	Failure in the control or drive circuits of the welding control board	In order to check the proper operation of these circuits it is necessary to use specific test and troubleshooting tools. Anyway, a visual inspection coul be enough to localise possible damages caused by a failure. In case of evidence of damages consider the suggested action.	Replace the welding control board **ATTENTION** **For the CT 230 only, there is a risk of failure propagation towards the chopper. Before replacing this board please check that the chopper works properly. If not replace both.**
P4 Lack of welding current control	Full welding power (without current control) regardless of the knob position	Failure in the control or drive circuits of the welding control board	In order to check the proper operation of these circuits it is necessary to use specific test and troubleshooting tools. Anyway, a visual inspection coul be enough to localise possible damages caused by a failure. In case of evidence of damages consider the suggested action.	Replace the welding control board **ATTENTION** **For the CT 230 only, there is a risk of failure propagation towards the chopper. Before replacing this board please check that the chopper works properly. If not replace both.**
P5 No welding arc	No open circuit voltage or welding available current low or negligible. With auto-idle installed, the r.p.m. never slows-down to idle.	Hall sensor failed	Disconnect the Hall sensor from the welding control board (on the WAC or within the electrical box, as applicable) and check that, in this condition, the open circuit voltage reading is correct. When the VRD is installed, the voltage goes to VRD value. If a resistive load bank is available, check that it is possible draw power (do not exceed 100A). If the Auto-idle is installed, in this condition the machine does not exit the idle. In any case, don't try to weld with the Hall sensor disconnected. If the test gives positive result, consider the indicated action.	Replace the Hall sensor

PROBLEM	ASSOCIATED SYMPTOMS	POSSIBLE CAUSE	VERIFICATIONS	WHAT TO DO
P6 Lack of voltage control in CV mode (applicable to the CC-CV machines provided with filter board)	The open circuit voltage in CV mode is the same as for the CC mode, regardless of the control knob position	Failure in the EMC filter board on the welding sockets	Check by means of a multimeter (stopped machine) the resistence value between positive welding socket and the corresponding faston connector on the filter board. The condition to check is: ohmic value between + welding socket and + board faston (the one to which the red cables are connected) < 4 ohm In case of condition not satisfied take the indicated corrective action.	Replace the EMC filter board
P7 No welding arc (applicable to the machines provided with the filter board on the welding sockets)	The open circuit voltage is zero	Failure in the EMC filter board on the welding sockets	Check by means of a multimeter (stopped machine) the resistence value between positive welding socket and the corresponding faston connector on the filter board. The condition to check is: ohmic value between - welding socket and - board faston (the one to which the black cables are connected) < 4 ohm In case of condition not satisfied take the indicated corrective action.	Replace the EMC filter board
P8 Minimum welding current in CC mode too high (applicable to the machines provided with the filter board on the welding sockets)	The welding current in CC mode with the knob at beginning of scale is too high and changes when turning the arc force knob (if present, switch in ON position)	Failure in the EMC filter board on the welding sockets	Check by means of a multimeter (stopped machine) the resistence value between positive welding socket and the corresponding faston connector on the filter board. The condition to check is: ohmic value between + welding socket and + board faston (the one to which the red cables are connected) < 4 ohm In case of condition not satisfied take the indicated corrective action.	Replace the EMC filter board
P9 Minimum welding current in CC mode too high	The welding current in CC mode with the knob at beginning of scale is too high and changes when turning the arc force knob (if present, switch in ON position)	Cable interruption between the WAC or the welding control board (as applicable depending on the machine type) and the welding sockets	With the machine stopped, extract the connector plugged to J1 of the WAC / Welding control board (as applicable depending on the machine type). Check by means of a multimeter the continuity between pin 6 of the connector and the positive welding socket. The resistive value shall be < 4 ohm if there is a filter board behind the sockets, otherwise shall be < 0.5 ohm. In case of condition not satisfied take the indicated corrective action.	Fix the cabling or replace it.
P10 No welding arc	The open circuit voltage is zero	Cable interruption between the WAC or the welding control board (as applicable depending on the machine type) and the welding sockets	With the machine stopped, extract the connector plugged to J1 of the WAC / Welding control board (as applicable depending on the machine type). Check by means of a multimeter the continuity between pin 5 of the connector and the negative welding socket. The resistive value shall be < 4 ohm if there is a filter board behind the sockets, otherwise shall be < 0.5 ohm. In case of condition not satisfied take the indicated corrective action	Fix the cabling or replace it.

PROBLEM	ASSOCIATED SYMPTOMS	POSSIBLE CAUSE	VERIFICATIONS	WHAT TO DO
P11 Lack of welding current control	Full welding power (without current control) regardless of the knob position. When the auto-idle is installed, the machine remains at low r.p.m.	Hall sensor failed	In order to check the proper operation of the Hall sensor it is necessary to use specific test and troubleshooting tools. Anyway, a visual inspection coul be enough to localise possible damages, with particular reference to possible wear of the cable end coming out of the Hall sensor potting. Please check also the connector contacts crimping at the opposite end of the cable. In case of evidence of damages consider the suggested action	Replace the Hall sensor
P12 Lack of welding current control **(applicable only to CT 350)**	Full welding power (without current control) regardless of the knob position	Chopper and/or driver board failed	Disconnect the chopper cable from the connector J3 of the WAC. Check that the open circuit voltage is < 1V. If not put a light resistive load at the welding output (few kohms are enough) and check again the previous condition. If it is not satisfied the chopper is faulty. If a welding load bank and a clamp DC amp meter are available, another test can be done to localise the failed section/s. To this purpose set the load bank for a current of a few tens of amps and measure the current at the output of each chopper section (the group of cables which connect the chopper to one end of the welding current leveling reactor). The sections through which the current flows are failed or improperly driven by the driver board. If the test confirms this type of failure consider the suggested corrective action.	Replace the chopper and the driver board
P13 Lack of welding current control **(applicable only to CT 230)**	Full welding power (without current control) regardless of the knob position	Chopper faulty	Disconnect the chopper cable from the connector J3 of the WAC. Check that the open circuit voltage is < 1V. If not put a light resistive load at the welding output (few kohms are enough) and check again the previous condition. If it is not satisfied the chopper is faulty. In this case consider the suggested corrective action.	Replace the chopper
P14 Knob irregular or missing current adjustment	When turning the knob the current setting (and the voltage setting, if applicable) do not change or change irregularly	The potentiometer which regulates the welding current (and the welding voltage, when applicable) is faulty	Check if the regulation through remote control works properly. If confirmed, consider the suggested corrective action.	Replace the potentiometer

⚠ WARNING

- Have **qualified** personnel do maintenance and troubleshooting work.
- Stop the engine before doing any work inside the machine. If for any reason the machine must be operated while working inside, **pay attention** moving parts, hot parts (exhaust manifold and muffler, etc.) electrical parts which may be unprotected when the machine is open.
- Remove guards only when necessary to perform maintenance, and replace them when the maintenance requiring their removal is complete.
- Use suitable tools and clothes.
- Do not modify the components if not authorized.

- See pag. M1.1 -

MOVING PARTS can injure

HOT surface can hurt you

NOTE

By maintenance at care of the utilizer we intend all the operatios concerning the verification of mechanical parts, electrical parts and of the fluids subject to use or consumption during the normal operation of the machine.

For what concerns the fluids we must consider as maintenance even the periodical change and or the refills eventually necessary.

Maintenance operations also include machine cleaning operations when carried out on a periodic basis outside of the normal work cycle.

The repairs **cannot be considered** among the maintenance activities, i.e. the replacement of parts subject to occasional damages and the replacement of electric and mechanic components consumed in normal use, by the Assistance Authorized Center as well as by MOSA.

The replacement of tires (for machines equipped with trolleys) must be considered as repair since it is not delivered as standard equipment any lifting system.

The periodic maintenance should be performed according to the schedule shown in the engine manual. An optional hour counter (M) is available to simplify the determination of the working hours.

⚠ IMPORTANT

In the maintenance operations avoid that polluting substances, liquids, exhausted oils, etc. bring damage to people or things or can cause negative effects to surroindings, health or safety respecting completely the laws and/ or dispositions in force in the place.

ENGINE and ALTERNATOR

PLEASE REFER TO THE SPECIFIC MANUALS PROVIDED.

Every engine and alternator manufacturer has maintenance intervals and specific checks for each model: it is necessary to consult the specific engine or alternator USER AND MAINTENANCE manual.

VENTILATION

Make certain there are no obstructions (rags, leaves or other) in the air inlet and outlet openings on the machine, alternator and motor.

ELECTRICAL PANELS

Check condition of cables and connections daily.
Clean periodically using a vacuum cleaner, **DO NOT USE COMPRESSED AIR.**

DECALS AND LABELS

*All warning and decals should be checked once a year and **replaced** if missing or unreadable.*

STRENUOUS OPERATING CONDITIONS

Under extreme operating conditions (frequent stops and starts, dusty environment, cold weather,extended periods of no load operation, fuel with over 0.5% sulphur content) do maintenance more frequently.

BATTERY WITHOUT MAINTENANCE
DO NOT OPEN THE BATTERY

The battery is charged automatically from the battery charger circuit suppplied with the engine.

Check the state of the battery from the colour of the warning light which is in the upper part.

- Green colour: battery OK
- Black colour: battery to be recharged
- White colour: battery to be replaced

⚠ NOTE

THE ENGINE PROTECTION NOT WORK WHEN THE OIL IS OF LOW QUALITY BECAUSE NOT CHARGED REGULARLY AT INTERVALS AS PRESCRIBED IN THE OWNER'S ENGINE MANUAL.

In case the machine should not be used for more than 30 days, make sure that the room in which it is stored presents a suitable shelter from heat sources, weather changes or anything which can cause rust, corrosion or damages to the machine.

☞ Have **qualified** personnel prepare the machine for storage.

GASOLINE ENGINE

Start the engine: It will run until it stops due to the lack of fuel.

Drain the oil from the engine sump and fill it with new oil (see page M25).

Pour about 10 cc of oil into the spark plug hole and screw the spark plug, after having rotated the crankshaft several times.

Rotate the crankshaft slowly until you feel a certain compression, then leave it.

In case the battery, for the electric start, is assembled, disconnect it.

Clean the covers and all the other parts of the machine carefully.

Protect the machine with a plastic hood and store it in o dry place.

DIESEL ENGINE

For short periods of time it is advisable, about every 10 days, to make the machine work with load for 15-30 minutes, for a correct distribution of the lubricant, to recharge the battery and to prevent any possible bloking of the injection system.

For long periods of inactivity, turn to the after soles service of the engine manufacturer.

Clean the covers and all the other parts of the machine carefully.

Protect the machine with a plastic hood and store it in a dry place.

In case of necessity for first aid and of fire prevention, see page. M2.5.

IMPORTANT

In the storage operations avoid that polluting substances, liquids, exhausted oils, etc. bring damage to people or things or can cause negative effects to surroindings, health or safety respecting completely the laws and/or dispositions in force in the place.

☞ Have **qualified** personnel disassemble the machine and dispose of the parts, including the oil, fuel, etc., in a correct manner when it is to be taken out of service.

As cust off we intend all operations to be made, at utilizer's care, at the end of the use of the machine. This comprises the dismantling of the machine, the subdivision of the several components for a further reutilization or for getting rid of them, the eventual packing and transportation of the eliminated parts up to their delivery to the store, or to the bureau encharged to the cust off or to the storage office, etc.

The several operations concerning the cust off, involve the manipulation of fluids potentially dangerous such as: lubricating oil and battery electrolyte.

The dismantling of metallic parts liable to cause injuries or wounds, must be made wearing heavy gloves and using suitable tools.

The getting rid of the various components of the machine must be made accordingly to rules in force of law a/o local rules.
Particular attention must be paid when getting rid of:
lubricating oils, battery electrolyte, and inflamable liquids such as fuel, cooling liquid.

The machine user is responsible for the observance of the norms concerning the environment conditions with regard to the elimination of the machine being cust off and of all its components.

In case the machine should be cust off without any previous disassembly it is however compulsory to remove:
- tank fuel
- engine lubricating oil
- cooling liquid from the engine
- battery

NOTE: MOSA is involved with custing off the machine **only** for the second hand ones, when not reparable.
This, of course, after authorization.

In case of necessity for first aid and fire prevention, see page M2.5.

IMPORTANT

In the cust-off operations avoid that polluting substances, liquids, exhausted oils, etc. bring damage to people or things or can cause negative effects to surroindings, health or safety respecting completely the laws and/or dispositions in force in the place.

The information here below are to be intended only as indicative since the above norm is much larger.
For further details please see the specific norms and/or the manufacturers of the product to be used in the welding process.

RUTILE ELECTRODES: E 6013

Easily removable fluid slag, suitable foe welding in all position.
Rutile electrodes weld in d.c. with both polarities (electrode holder at + or -) and in a.c..
Suitable for soft steels R-38/45 kg/mm^2 . Also for soft steels of lower quality.

BASIC ELECTRODES: E 7015

Basic electrrodes wels onlu in d.c. with inverse polarity (+ on the electrode holder) ; there are also types for a.c.
Suitable for impure carbon steels. Weld in all position.

HIGH YIELD BASIC ELECTRODES: E 7018

The iron contained in the coating increases the quality of metal added. Good mechanical properties. Weld in all position.
Electrode holder at + (inverse polarity). Wld deposit of nice aspect, also vertical. Workable; high yield.
Suitable for steels with high contens of sulphur (impurities).

CELLULOSIC ELECTRODES: E 6010

Cellulosic electrodes weld only in d.c. with polarity + electrode holder - ground clamp.
Special for steels run on pipes with R max 55 kg/mm^2. Weld in all position. volatile slag.

ELECTRODES IDENTIFICATION ACCORDING TO A.W.S. STANDARDS

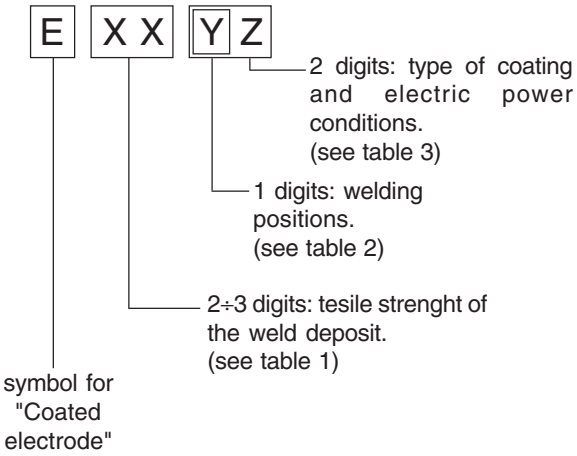
E X X Y Z
2 digits: type of coating and electric power conditions. (see table 3)
1 digits: welding positions. (see table 2)
2÷3 digits: tesile strenght of the weld deposit. (see table 1)
symbol for "Coated electrode"

Number	Strenght	
	K.s.I.	Kg/mm^2
60	60.000	42
70	70.000	49
80	80.000	56
90	90.000	63
100	100.000	70
110	110.000	77
120	120.000	84

Table 1

1	for all positions
2	for plane and verticl
3	for plane posotion only

Table 2

N°	Descrizione
10	Cellulose electrodes for d.c.
11	Cellulose electrodes for a.c.
12	Rutile electrode for d.c.
13	Rutile electrode for a.c.
14	High yield rutile electrodes
15	Basic electrodes for d.c.
16	Basic electrodes for c.a.
18	High yield basic electrodes for d.c. (inverse polarity)
20	Acid electrodes for flat or front position welding for d.c. (- pole) and for a.c.
24	High yield rutile electrodes for flat or front plane position welding for d.c. and a.c.
27	High yield acid electrodes for flat or front plane position welding for d.c. (- pole) and a.c..
28	High yield basic electrodes for flat or front plane position welding for d.c. (inverse polarity)
30	Extra high yield acid electrodes, extra high penetration if required, for flat position welding only for d.c. (- pole) and a.c.

Table 3

A : Alternator
B : Wire connection unit
C : Capacitor
D : G.F.I.
E : Welding PCB transformer
F : Fuse
G : 400V 3-phase socket
H : 230V 1phase socket
I : 110V 1-phase socket
L : Socket warning light
M : Hour-counter
N : Voltmeter
P : Welding arc regulator
Q : 230V 3-phase socket
R : Welding control PCB
S : Welding current ammeter
T : Welding current regulator
U : Current transformer
V : Welding voltage voltmeter
Z : Welding sockets
X : Shunt
W : D.C. inductor
Y : Welding diode bridge

A1 : Arc striking resistor
B1 : Arc striking circuit
C1 : 110V D.C./48V D.C. diode bridge
D1 : E.P.1 engine protection
E1 : Engine stop solenoid
F1 : Acceleration solenoid
G1 : Fuel level transmitter
H1 : Oil or water thermostat
I1 : 48V D.C. socket
L1 : Oil pressure switch
M1 : Fuel warning light
N1 : Battery charge warning light
O1 : Oil pressure warning light
P1 : Fuse
Q1 : Starter key
R1 : Starter motor
S1 : Battery
T1 : Battery charge alternator
U1 : Battery charge voltage regulator
V1 : Solenoid valve control PCBT
Z1 : Solenoid valve
W1 : Remote control switch
X1 : Remote control and/or wire feeder socket
Y1 : Remote control plug

A2 : Remote control welding regulator
B2 : E.P.2 engine protection
C2 : Fuel level gauge
D2 : Ammeter
E2 : Frequency meter
F2 : Battery charge trasformer
G2 : Battery charge PCB
H2 : Voltage selector switch
I2 : 48V a.c. socket
L2 : Thermal relay
M2 : Contactor
N2 : G.F.I. and circuit breaker
O2 : 42V EEC socket
P2 : G.F.I. resistor
Q2 : T.E.P. engine protection
R2 : Solenoid control PCBT
S2 : Oil level transmitter
T2 : Engine stop push-button T.C.1
U2 : Engine start push-buttonT.C.1
V2 : 24V c.a. socket
Z2 : Thermal magnetic circuit breaker
W2 : S.C.R. protection unit
X2 : Remote control socket
Y2 : Remote control plug

A3 : Insulation moitoring
B3 : E.A.S. connector
C3 : E.A.S. PCB
D3 : Booster socket
E3 : Open circuit voltage switch
F3 : Stop push-button
G3 : Ignition coil
H3 : Spark plug
I3 : Range switch
L3 : Oil shut-down button
M3 : Battery charge diode
N3 : Relay
O3 : Resistor
P3 : Sparkler reactor
Q3 : Output power unit
R3 : Electric siren
S3 : E.P.4 engine protection
T3 : Engine control PCB
U3 : R.P.M. electronic regulator
V3 : PTO HI control PCB
Z3 : PTO HI 20 l/min push-button
W3 : PTO HI 30 l/min push-button
X3 : PTO HI reset push-button
Y3 : PTO HI 20 l/min indicator

A4 : PTO HI 30 l/min indicator
B4 : PTO HI reset indicator
C4 : PTO HI 20 l/min solenoid valve
D4 : PTO HI 30 l/ min solenoid valve
E4 : Hydraulic oil pressure switch
F4 : Hycraulic oil level gauge
G4 : Preheating glow plugs
H4 : Preheating gearbox
I4 : Preheating indicator
L4 : R.C. filter
M4 : Heater with thermostat
N4 : Choke solenoid
O4 : Step relay
P4 : Circuit breaker
Q4 : Battery charge sockets
R4 : Sensor, cooling liquid temperature
S4 : Sensor, air filter clogging
T4 : Warning light, air filter clogging
U4 : Polarity inverter remote control
V4 : Polarity inverter switch
Z4 : Transformer 230/48V
W4 : Diode bridge, polarity change
X4 : Base current diode bridge
Y4 : PCB control unit, polarity inverter

A5 : Base current switch
B5 : Auxiliary push-button ON/OFF
C5 : Accelerator electronic control
D5 : Actuator
E5 : Pick-up
F5 : Warning light, high temperature
G5 : Commutator auxiliary power
H5 : 24V diode bridge
I5 : Y/s commutator
L5 : Emergency stop button
M5 : Engine protection EP5
N5 : Pre-heat push-button
O5 : Accelerator solenoid PCB
P5 : Oil pressure switch
Q5 : Water temperature switch
R5 : Water heater
S5 : Engine connector 24 poles
T5 : Electronic GFI relais
U5 : Release coil, circuit breaker
V5 : Oil pressure indicator
Z5 : Water temperature indicator
W5 : Battery voltmeter
X5 : Contactor, polarity change
Y5 : Commutator/switch, series/parallel

A6 : Commutator/switch
B6 : Key switch, on/off
C6 : QEA control unit
D6 : Connector, PAC
E6 : Frequency rpm regulator
F6 : Arc-Force selector
G6 : Device starting motor
H6 : Fuel electro pump 12V c.c.
I6 : Start Local/Remote selector
L6 : Choke button
M6 : Switch CC/CV
N6 : Connector – wire feeder
O6 : 420V/110V 3-phase transformer
P6 : Switch IDLE/RUN
Q6 : Hz/V/A analogic instrument
R6 : EMC filter
S6 : Wire feeder supply switch
T6 : Wire feeder socket
U6 : DSP chopper PCB
V6 : Power chopper supply PCB
Z6 : Switch and leds PCB
W6 : Hall sensor
X6 : Water heather indicator
Y6 : Battery charge indicator

A7 : Transfer pump selector AUT-0-MAN
B7 : Fuel transfer pump
C7 : "GECO" generating set test
D7 : Flooting with level switches
E7 : Voltmeter regulator
F7 : WELD/AUX switch
G7 : Reactor, 3-phase
H7 : Switch disconnector
I7 : Solenoid stop timer
L7 : "VODIA" connector
M7 : "F" EDC4 connector
N7 : OFF-ON-DIAGN. selector
O7 : DIAGNOSTIC push-button
P7 : DIAGNOSTIC indicator
Q7 : Welding selector mode
R7 : VRD load
S7 : 230V 1-phase plug
T7 : V/Hz analogic instrument
U7 : Engine protection EP6
V7 : G.F.I. relay supply switch
Z7 : Radio remote control receiver
W7 : Radio remote control trasnsmitter
X7 : Isometer test push-button
Y7 : Remote start socket

A8 : Transfer fuel pump control
B8 : Ammeter selector switch
C8 : 400V/230V/115V commutator
D8 : 50/60 Hz switch
E8 : Cold start advance with temp. switch
F8 : START/STOP switch
G8 : Polarity inverter two way switch
H8 : Engine protection EP7
I8 : AUTOIDLE switch
L8 : AUTOIDLE PCB
M8 : A4E2 ECM engine PCB
N8 : Remote emergency stop connector
O8 : V/A digital instruments and led VRD PCB
P8 : Water in fuel
Q8 : Battery disconnect switch
R8 : Inverter
S8 : Overload led
T8 : Main IT/TN selector
U8 : NATO socket 12V
V8 : Diesel pressure switch
Z8 : Remote control PCB
W8 : Pressure turbo protection
X8 :
Y8 :

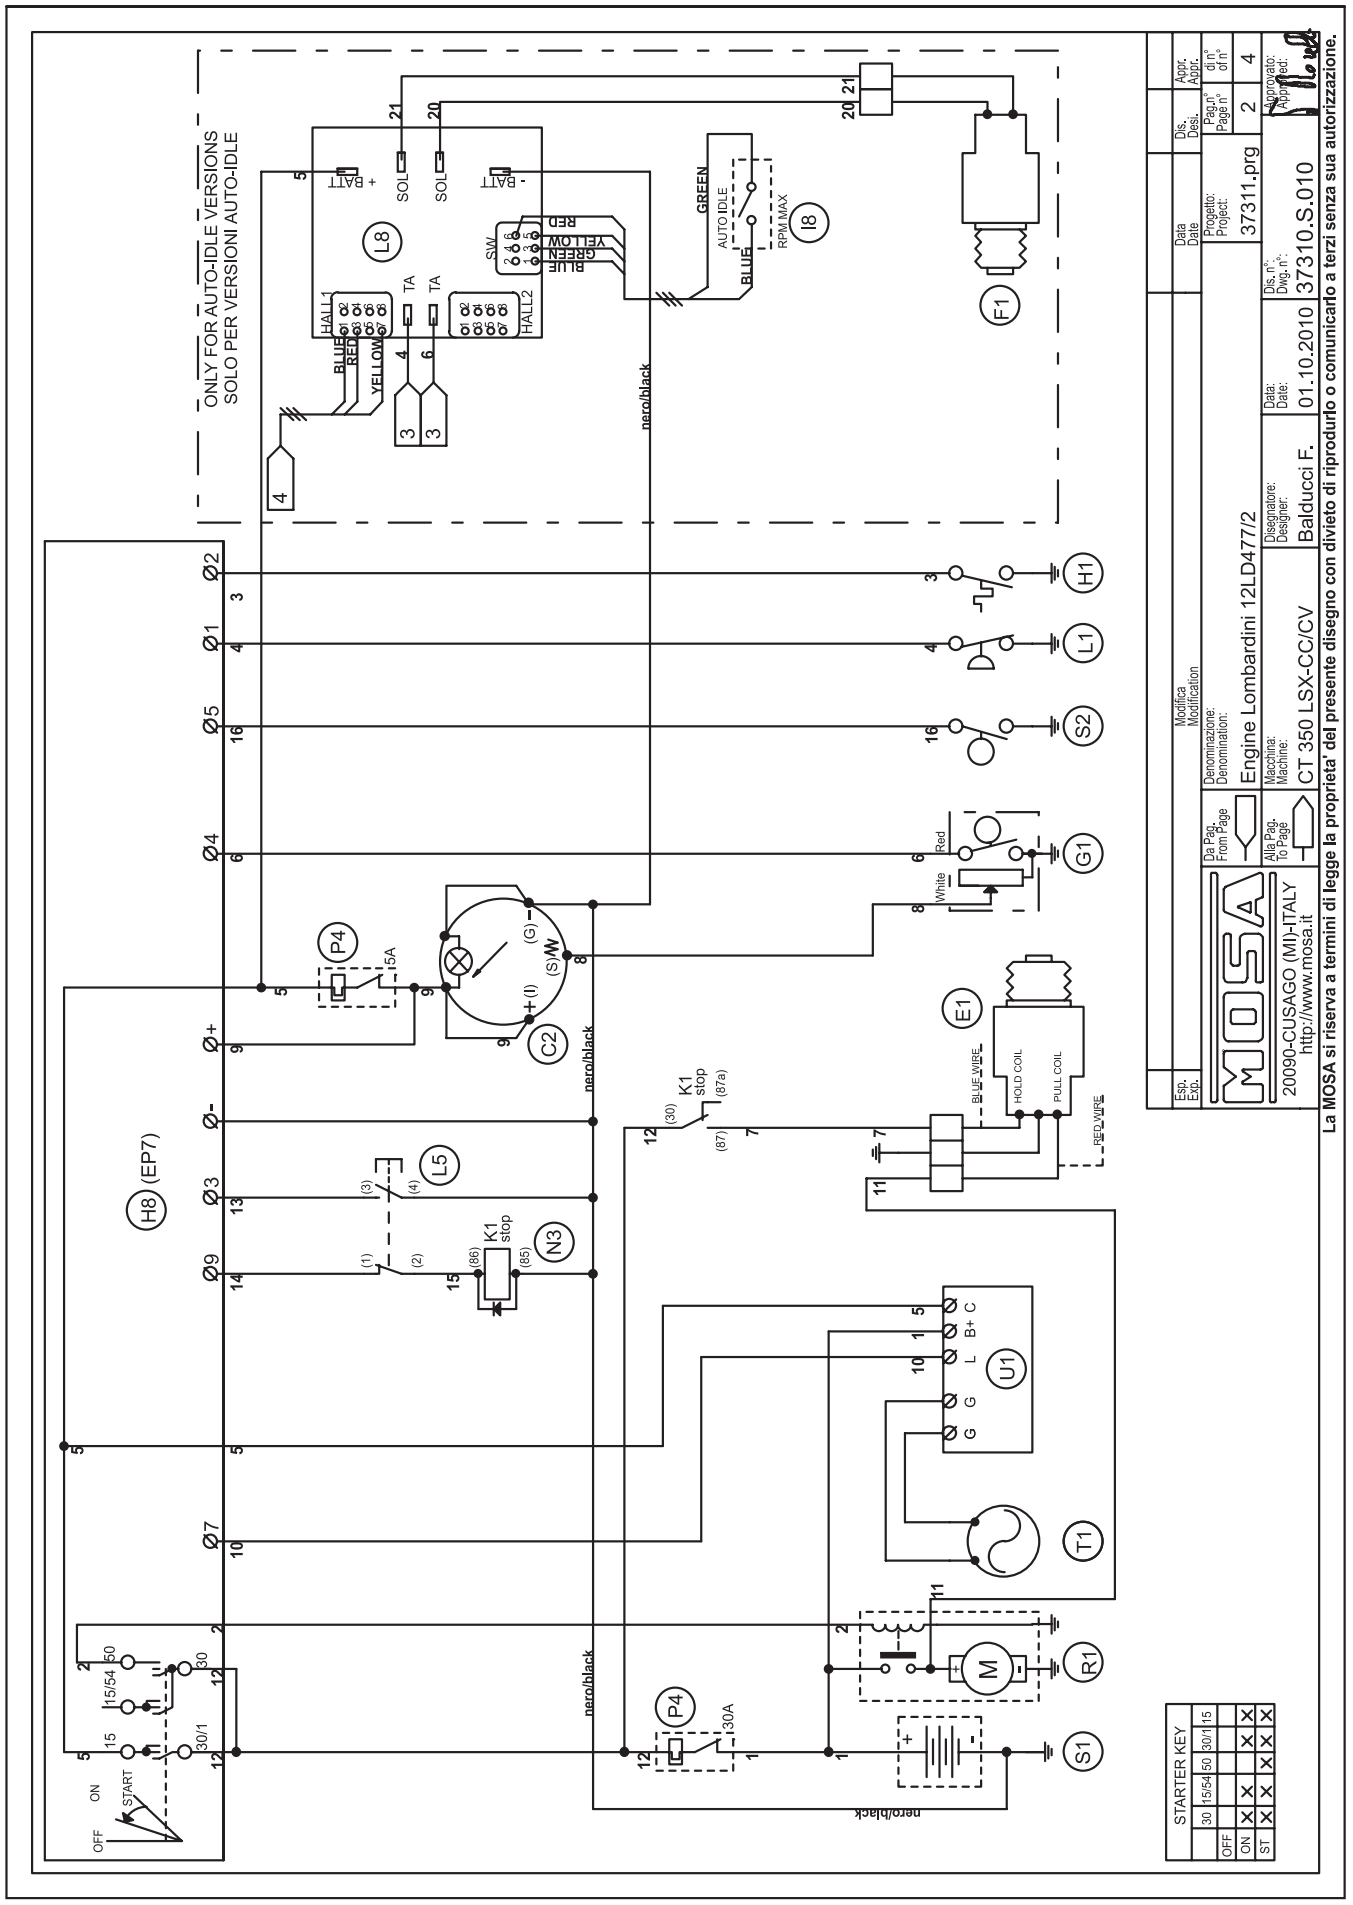

03/06/10 37310-I

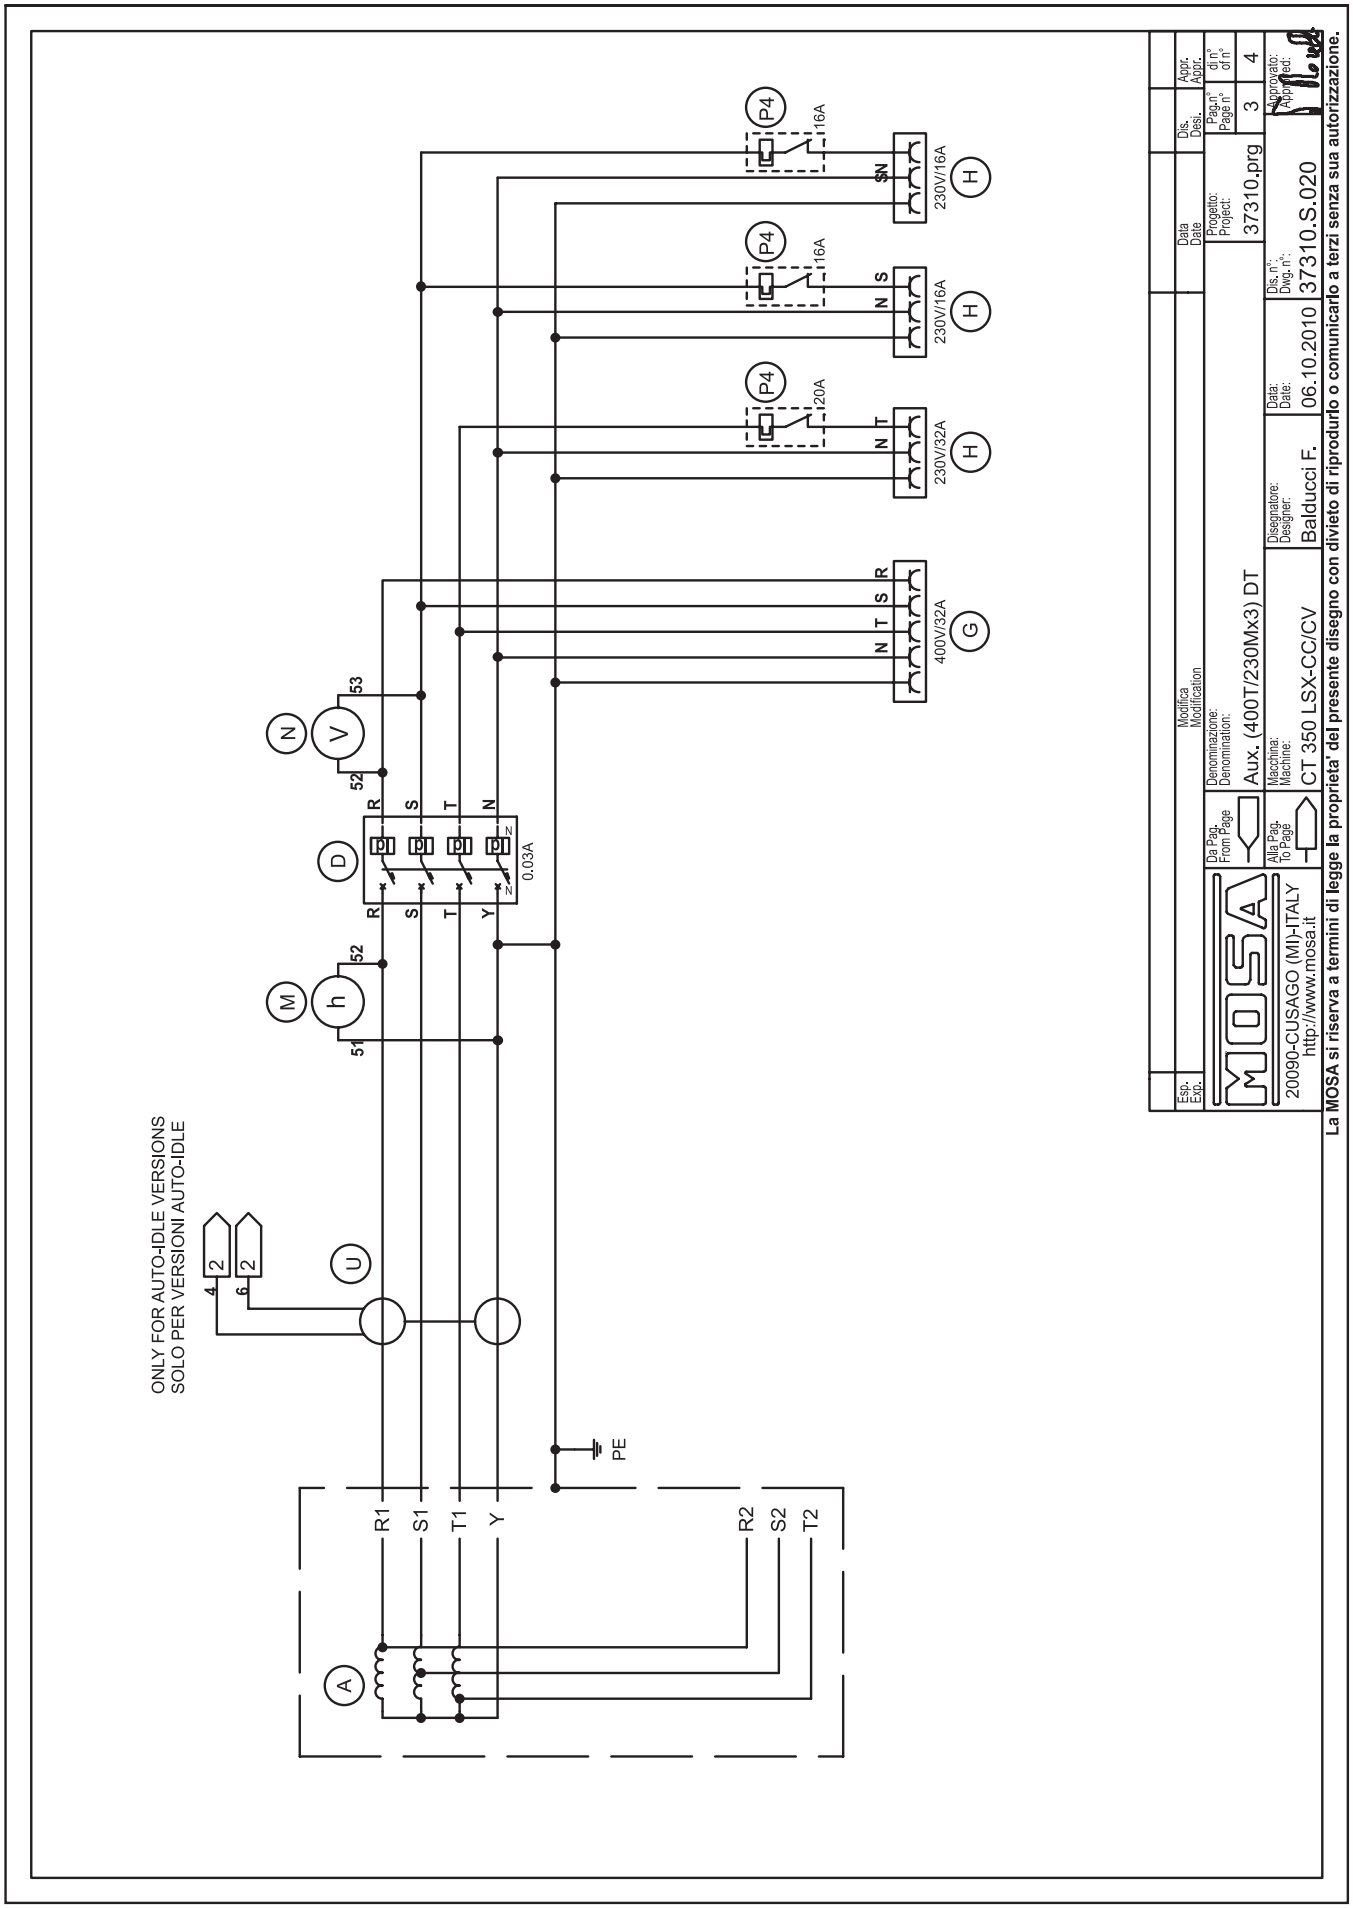
ONLY FOR AUTO-IDLE VERSIONS
SOLO PER VERSIONI AUTO-IDLE
PE
R1
S1
T1
Y
R2
S2
T2
0.03A
400V/32A
230V/32A
230V/16A
230V/16A
16A
16A
20A
Aux. (400T/230Mx3) DT
CT 350 LSX-CC/CV
Balducci F.
06.10.2010
37310.S.020
37310.prg
20090-CUSAGO (MI)-ITALY
http://www.mosa.it
La MOSA si riserva a termini di legge la proprieta' del presente disegno con divieto di riprodurlo o comunicarlo a terzi senza sua autorizzazione.

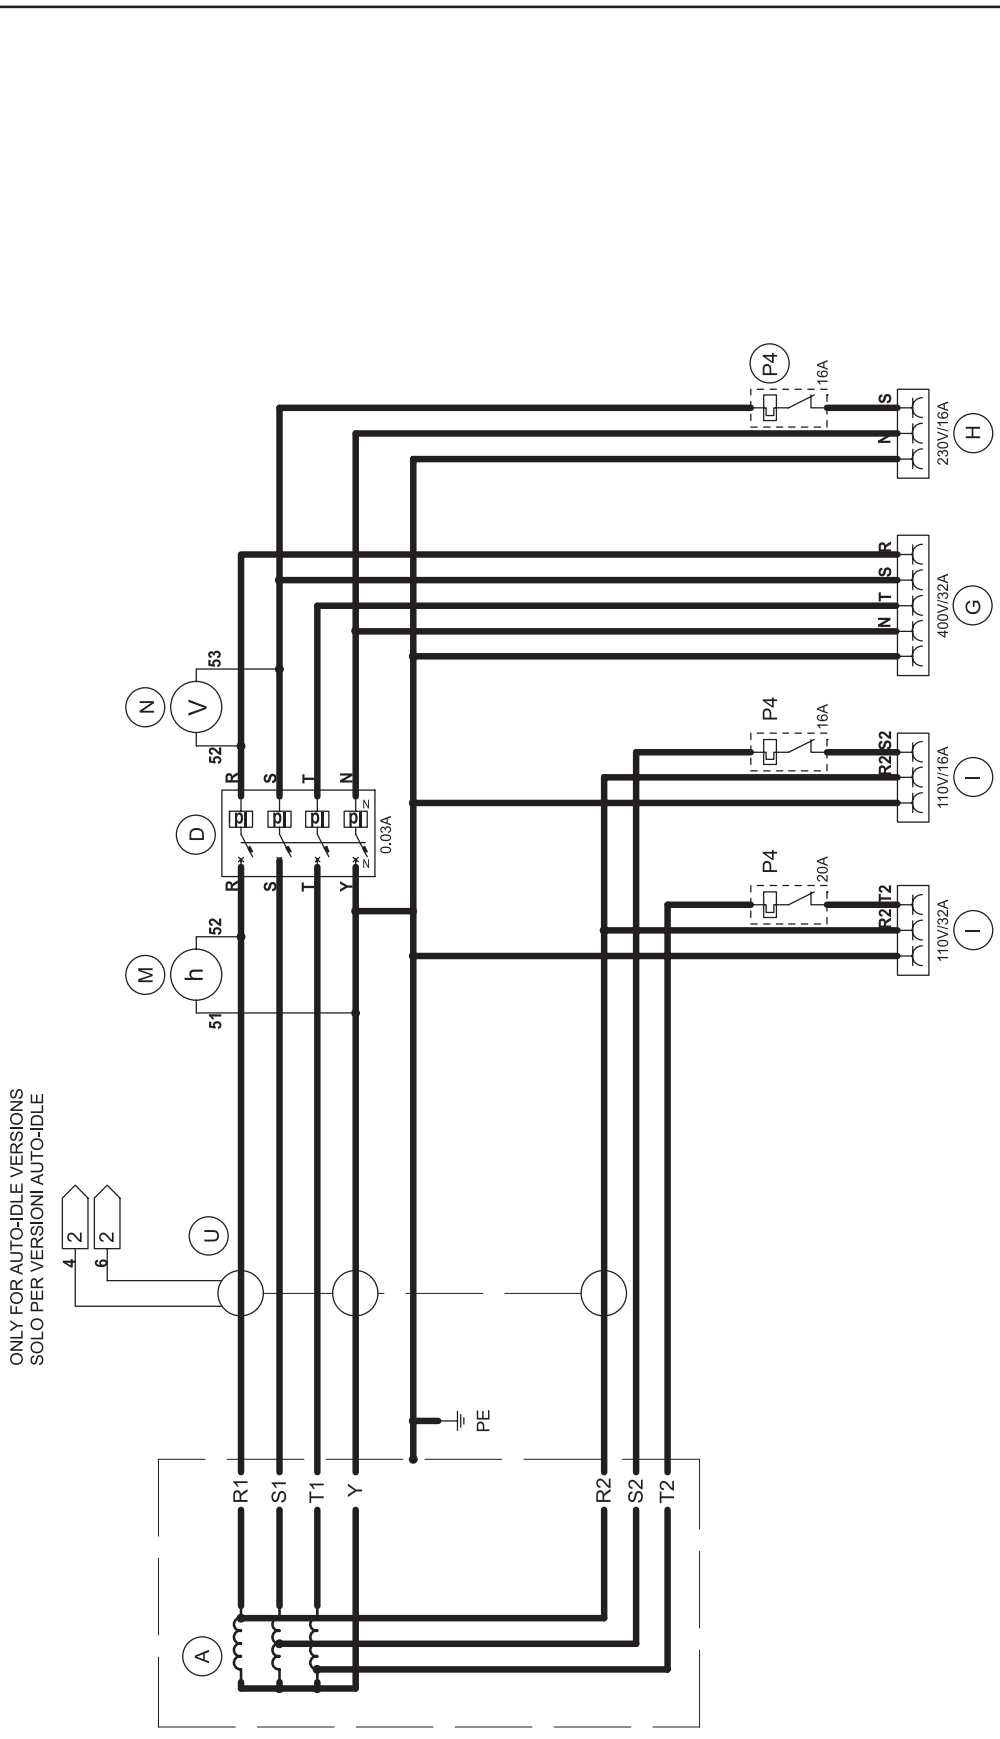

La MOSA si riserva a termini di legge la proprieta' del presente disegno con divieto di riprodurlo o comunicarlo a terzi senza sua autorizzazione.

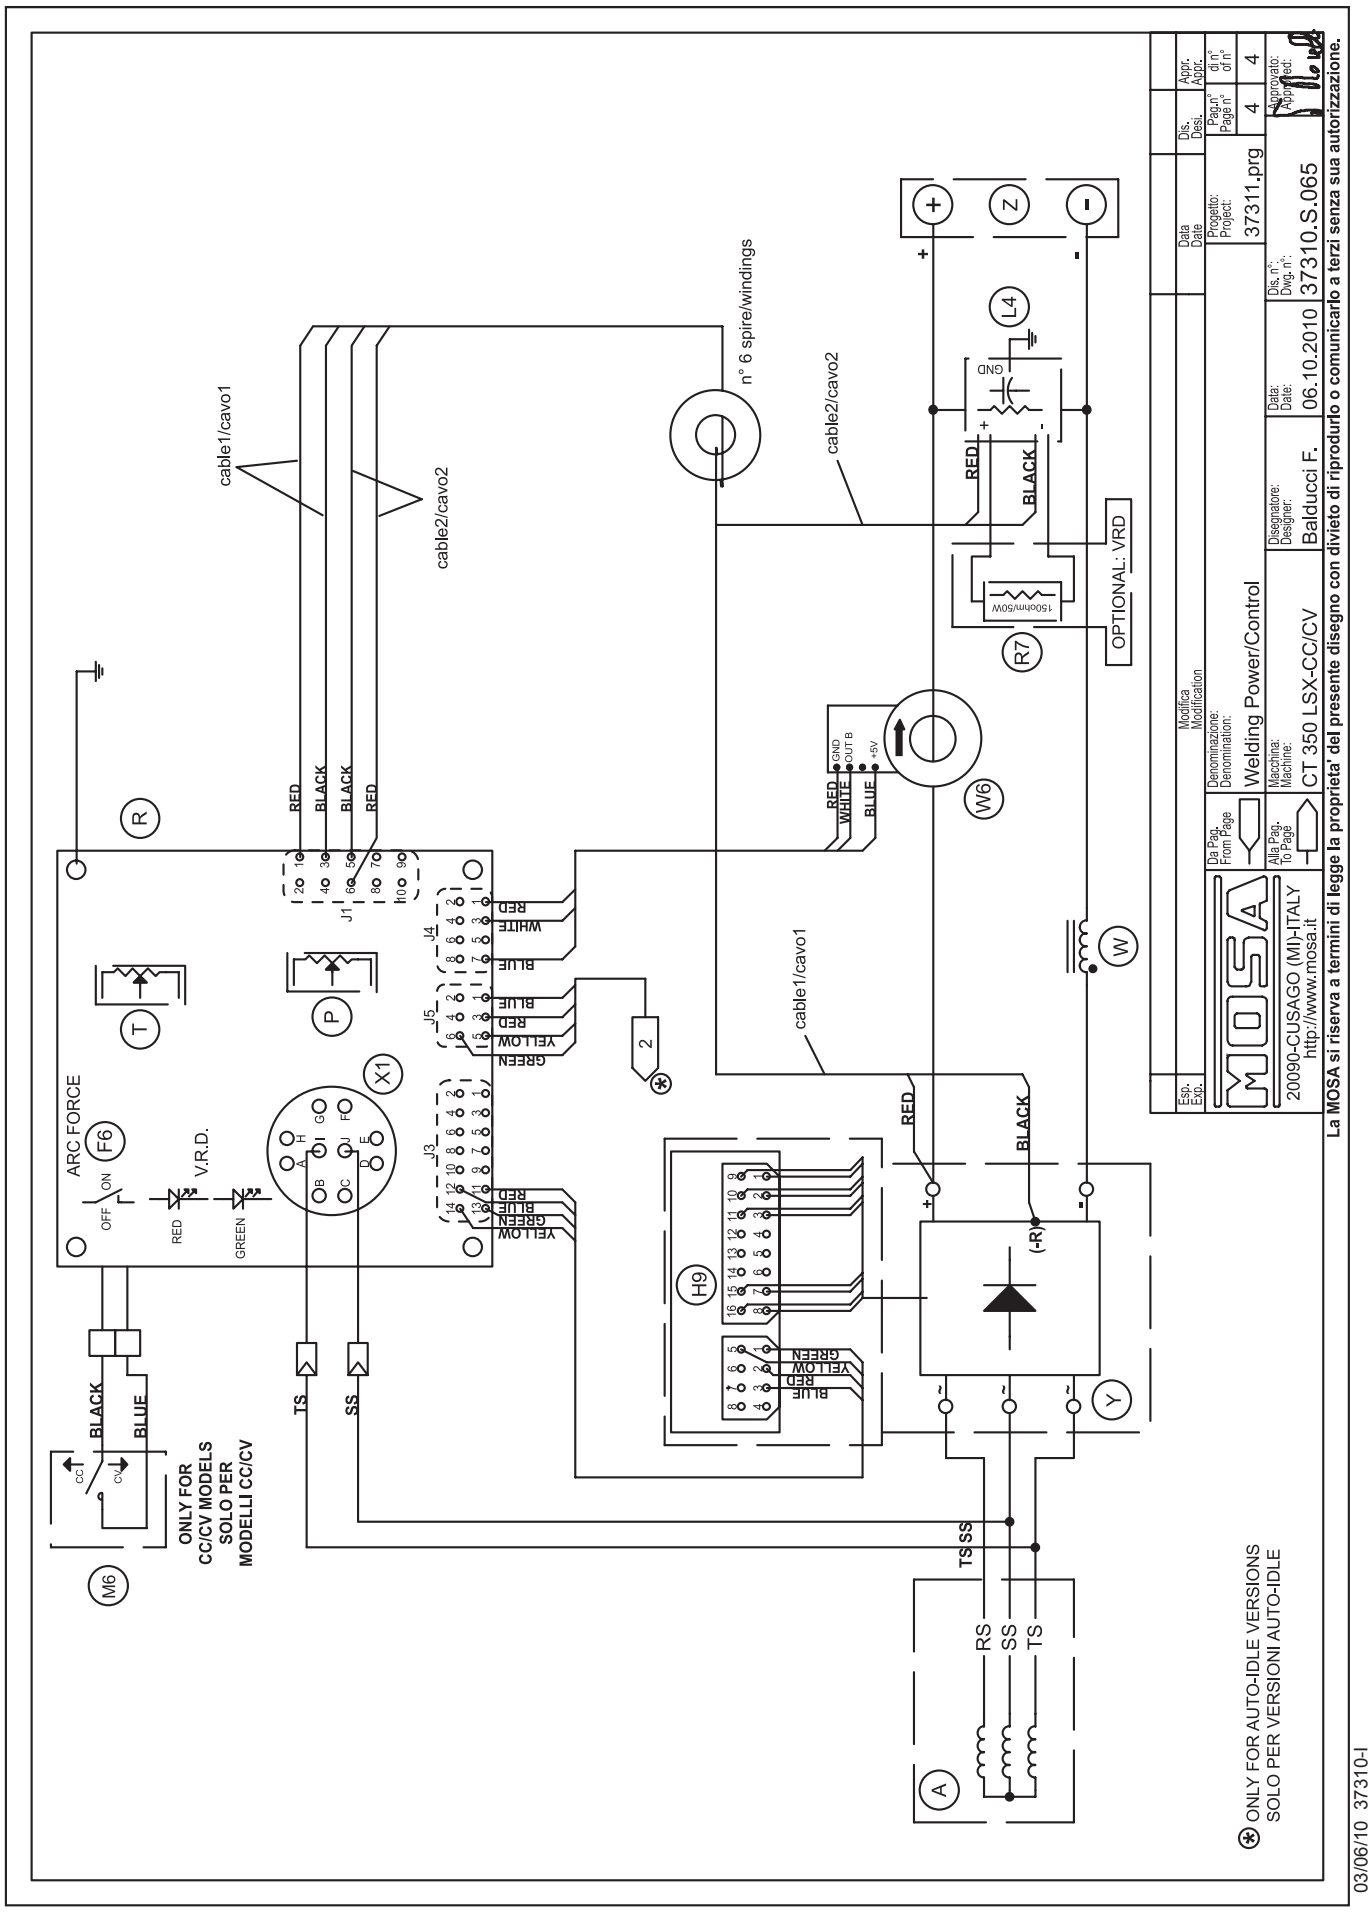
cable1/cavo1
cable2/cavo2
n° 6 spire/windings
OPTIONAL: VRD
ARC FORCE
V.R.D.
ONLY FOR CC/CV MODELS
SOLO PER MODELLI CC/CV
ONLY FOR AUTO-IDLE VERSIONS
SOLO PER VERSIONI AUTO-IDLE
Welding Power/Control
CT 350 LSX-CC/CV
37311.prg
37310.S.065
06.10.2010
Balducci F.
20090-CUSAGO (MI)-ITALY
http://www.mosa.it
La MOSA si riserva a termini di legge la proprieta' del presente disegno con divieto di riprodurlo o comunicarlo a terzi senza sua autorizzazione.